



fill level



water level



pressure



temperature



flow



visualization



signal converter



sensoric



Operating Instructions

MIR-491 and MIR-492

Industrial- and process controller

MIR-491



MIR-492



ACS-CONTROL-SYSTEM

knowhow with system

Your partner for measuring technology and automation








BlueControl

More efficiency in engineering,
more overview in operating:
The projecting environment for the BluePort® controllers

Description of symbols in the text:

-  General information
-  General warning
-  Attention: ESD-sensitive devices

on the device:


-  Follow the operating instructions

Contents

1	Mounting	5
2	Electrical connections	6
2.1	Connecting diagram	6
2.2	Terminal connection	7
3	Operation	11
3.1	Front view	11
3.2	Behaviour after power-on	12
3.3	Operating level	12
3.4	Error list / Maintenance manager	13
3.5	Self-tuning	16
3.5.1	Preparation for self-tuning	16
3.5.2	Optimization after start-up or at the set-point	17
3.5.3	Selecting the method (CONF / ENTER / TUNE).	17
3.5.4	Step attempt after start-up	18
3.5.5	Pulse attempt after start-up	18
3.5.6	Optimization at the set-point	18
3.5.7	Optimization at the set-point for 3-point stepping controller.	20
3.5.8	Self-tuning start	21
3.5.9	Self-tuning cancellation.	21
3.5.10	Acknowledgement procedures in case of unsuccessful self-tuning	22
3.5.11	Examples for self-tuning attempts	23
3.6	Manual self-tuning.	24
3.7	Second PID parameter set	25
3.8	Alarm handling	26
3.9	Operating structure	28
4	Configuration level	29
4.1	Configuration survey	29
4.2	Configuration parameters	30
4.3	Set-point processing	44
4.3.1	Set-point gradient / ramp	44
4.4	Switching behaviour.	45
4.4.1	Standard (CYCL = 0)	45

4.4.2	Switching attitude linear (CYCL = 1)	45
4.4.3	Switching attitude non-linear (CYCL = 2)	46
4.4.4	Heating and cooling with constant period (CYCL = 3)	47
4.5	Configuration examples	48
4.5.1	On-Off controller / Signaller (inverse)	48
4.5.2	2-point controller (inverse)	49
4.5.3	3-point controller (relay & relay)	50
4.5.4	3-point stepping controller (relay & relay)	51
4.5.5	Continuous controller (inverse)	52
4.5.6	ΔZ Y - Off controller / 2-point controller with pre-contact .	53
4.5.7	Continuous controller with position controller	54
4.5.8	Measured value output	55
5	Parameter setting level	56
5.1	Parameter survey	56
5.2	Parameters	57
5.3	Input scaling	60
5.3.1	Input I nP.1 and I nP.3.	60
5.3.2	Input I nP.2	60
6	Calibration level	61
7	Special functions	64
7.1	DAC [®] – motor actuator monitoring	64
7.2	O ₂ measurement	66
7.2.1	Connection	66
7.2.2	Configuration:.	67
7.3	MIR-49x as Modbus master.	68
7.4	Loop alarm.	69
7.5	Heating current input / heating current alarm	69
7.6	KS9x-1 as Modbus master.	70
7.7	Back-up controller (PROFIBUS)	70
8	BlueControl	71
9	Versions	72
10	Technical data	74
11	Safety hints	78
11.1	Resetting to factory setting,	80

1 Mounting

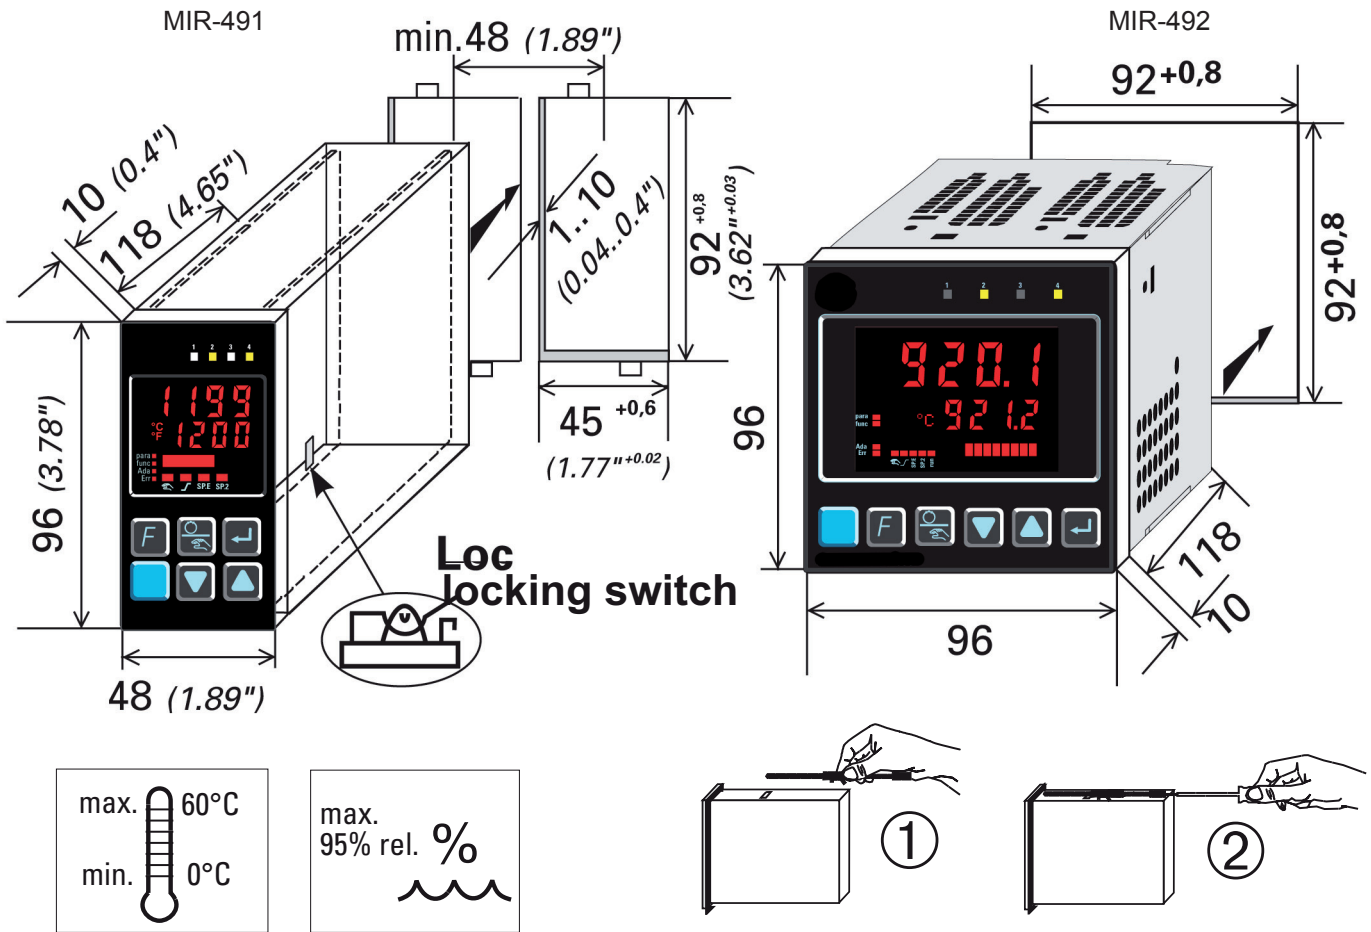

Fix the instrument **only at top and bottom** to avoid damaging it.

Safety switch:

For access to the safety switch, the controller must be withdrawn from the housing. Squeeze the top and bottom of the front bezel between thumb and forefinger and pull the controller firmly from the housing.

Loc	open	Access to the levels is as adjusted by means of BlueControl® (engineering tool)	②
	closed	①	all levels accessible without restriction

① Factory setting


② Default setting: display of all levels suppressed, password **PASS = OFF**



Caution! The unit contains ESD-sensitive components.

2 Electrical connections

2.1 Connecting diagram

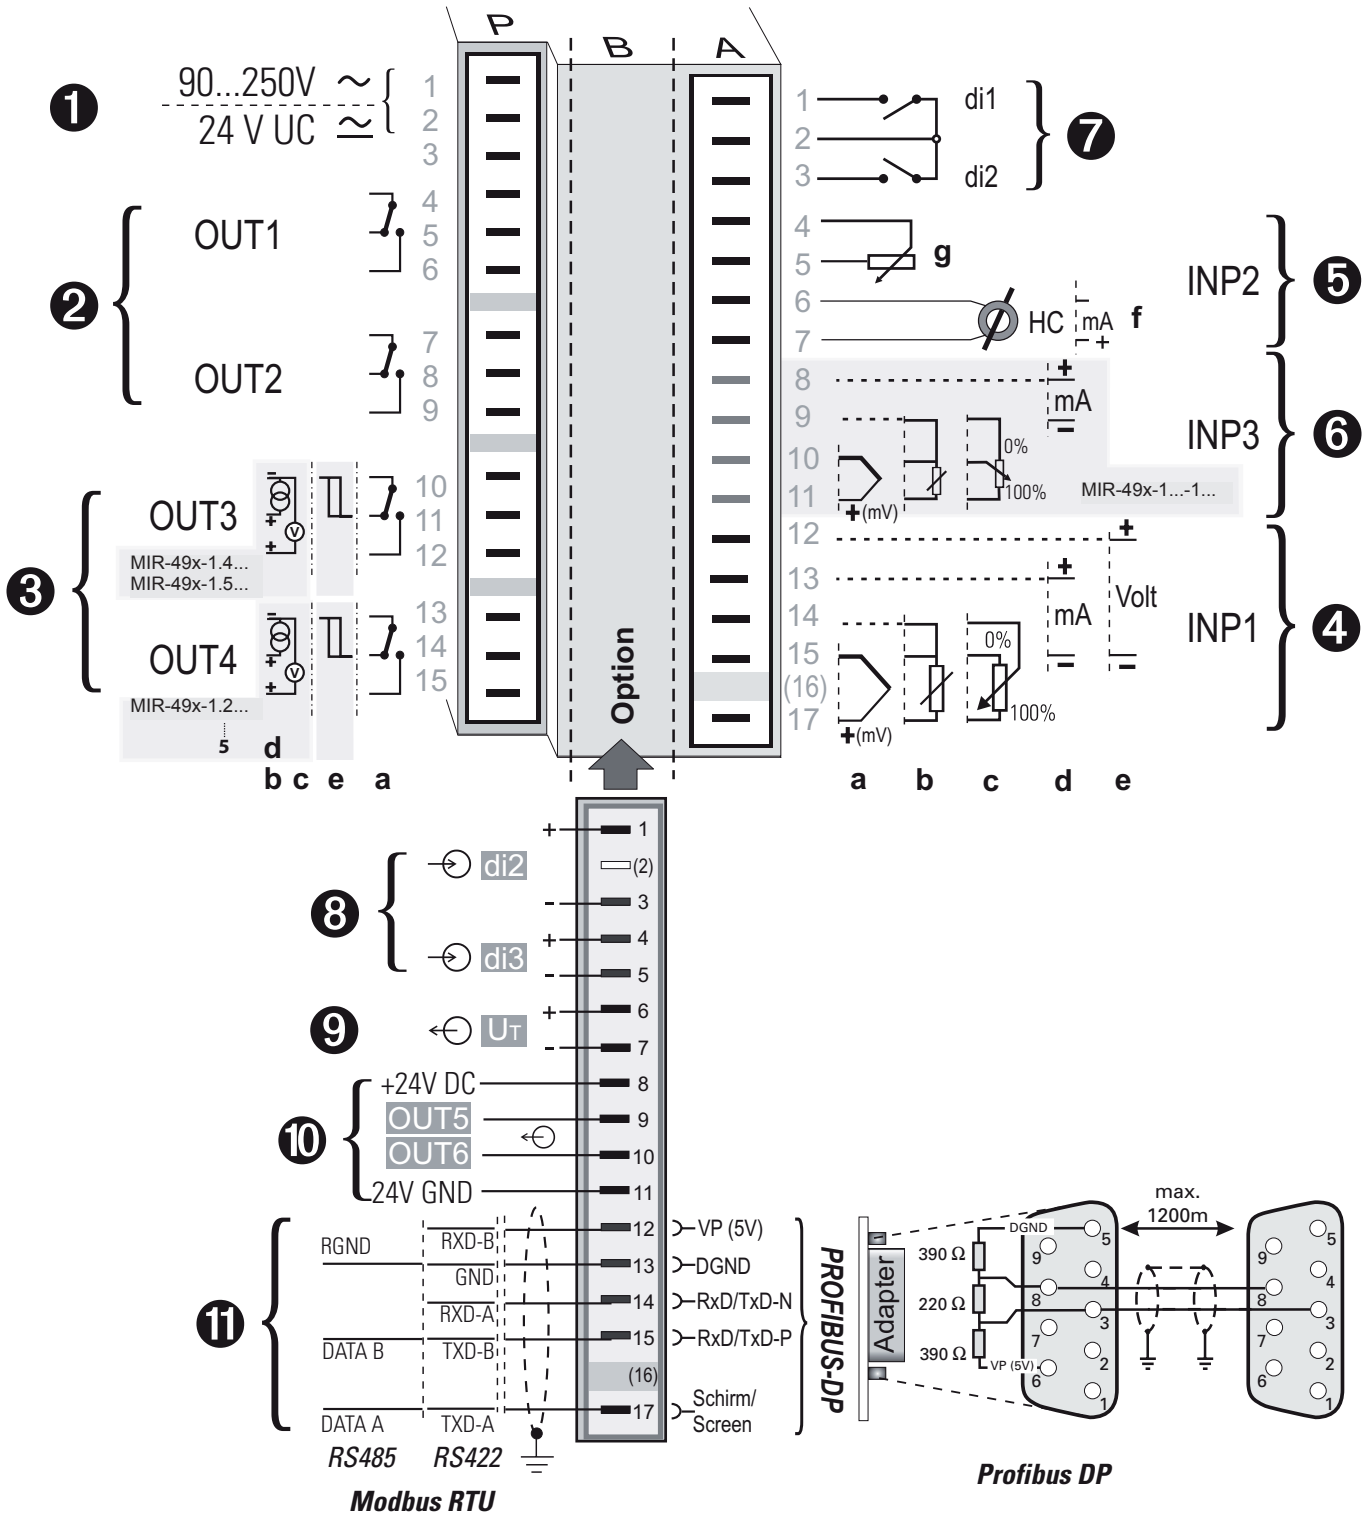

Dependent of order, the controller is fitted with :

- flat-pin terminals 1 x 6,3mm or 2 x 2,8mm to DIN 46 244 or
- screw terminals for 0,5 to 2,5mm²

On instruments with screw terminals, the insulation must be stripped by min. 12 mm. Choose end crimps accordingly!

2.2 Terminal connection

Power supply connection ①

See chapter "Technical data"

Connection of outputs OUT1/2 ②

Relay outputs (250V/2A), potential-free changeover contact

Connection of outputs OUT3/4 ③

a relay (250V/2A), potential-free changeover contact

universal output

b current (0/4...20mA)

c voltage (0/2...10V)

d transmitter supply

e logic (0..20mA / 0..12V)

Connection of input INP1 ④

Input mostly used for variable x1 (process value)

a thermocouple

b resistance thermometer (Pt100/ Pt1000/ KTY/ ...)

c current (0/4...20mA)

d voltage (0/2...10V)

Connection of input INP2 ⑤

f heating current input (0..50mA AC) or input for ext. set-point (0/4...20mA)

g potentiometer input for position feedback

Connection of input INP2 ⑤

a Heating current input (0...50mA AC) or input for ext. Set-point (0/4...20mA)

b Potentiometer input for position feedback

Connection of input INP3 ⑥

As input INP1, but without voltage


Connection of inputs di1, di2 ⑦

Digital input, configurable as switch or push-button

② OUT1/2 heating/cooling



⑤ INP2 current transformer

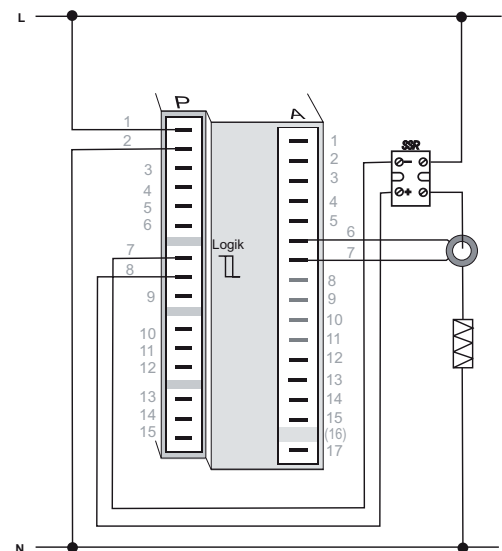

Connection of inputs di2/3 ⑧ (option)

Digital inputs (24VDC external), galvanically isolated, configurable as switch or push-button

Connection of output U_T ⑨ (option)

Supply voltage connection for external energization


Connection of outputs OUT5/6 ⑩ (option)

Digital outputs (opto-coupler), galvanic isolated, common positive control voltage, output rating: 18...32VDC

Connection of bus interface ⑪ (option)


PROFIBUS DP or RS422/485 interface with Modbus RTU protocol

⑧ ⑨ di2/3, 2-wire transmitter supply

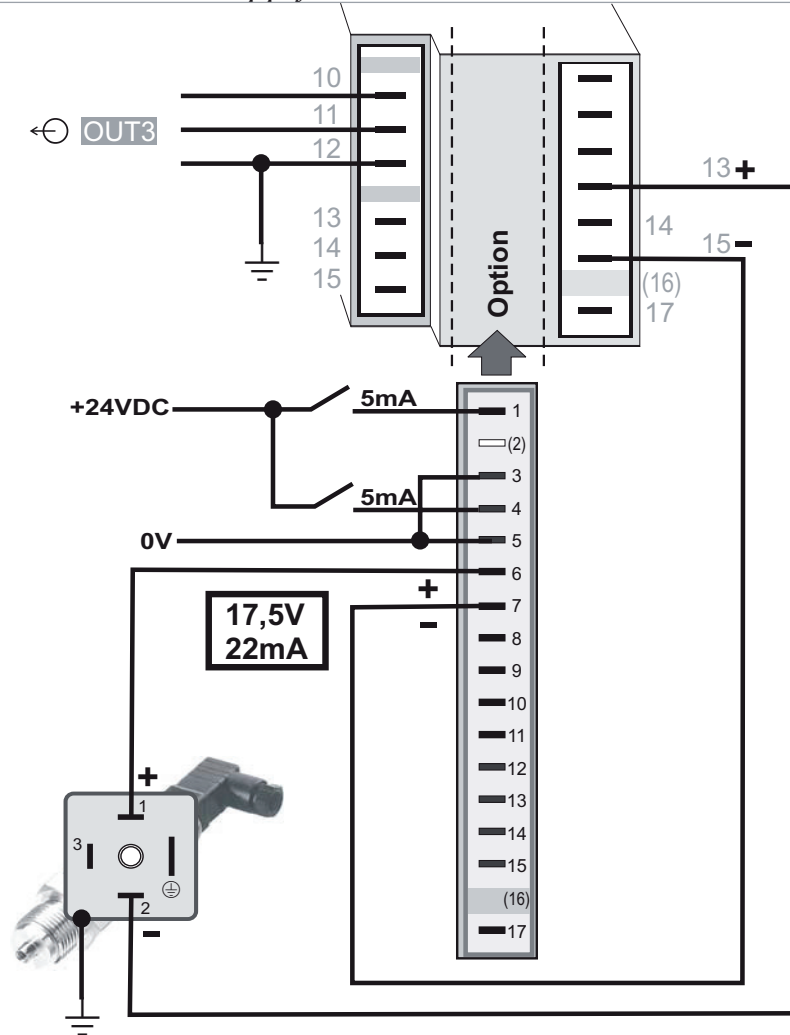


i Analog outputs OUT3 or OUT4 and transmitter supply U_T are connected to different voltage potentials. Therefore, take care not to make an external galvanic connection between OUT3/4 and U_T with analog outputs!

3 OUT3 transmitter supply

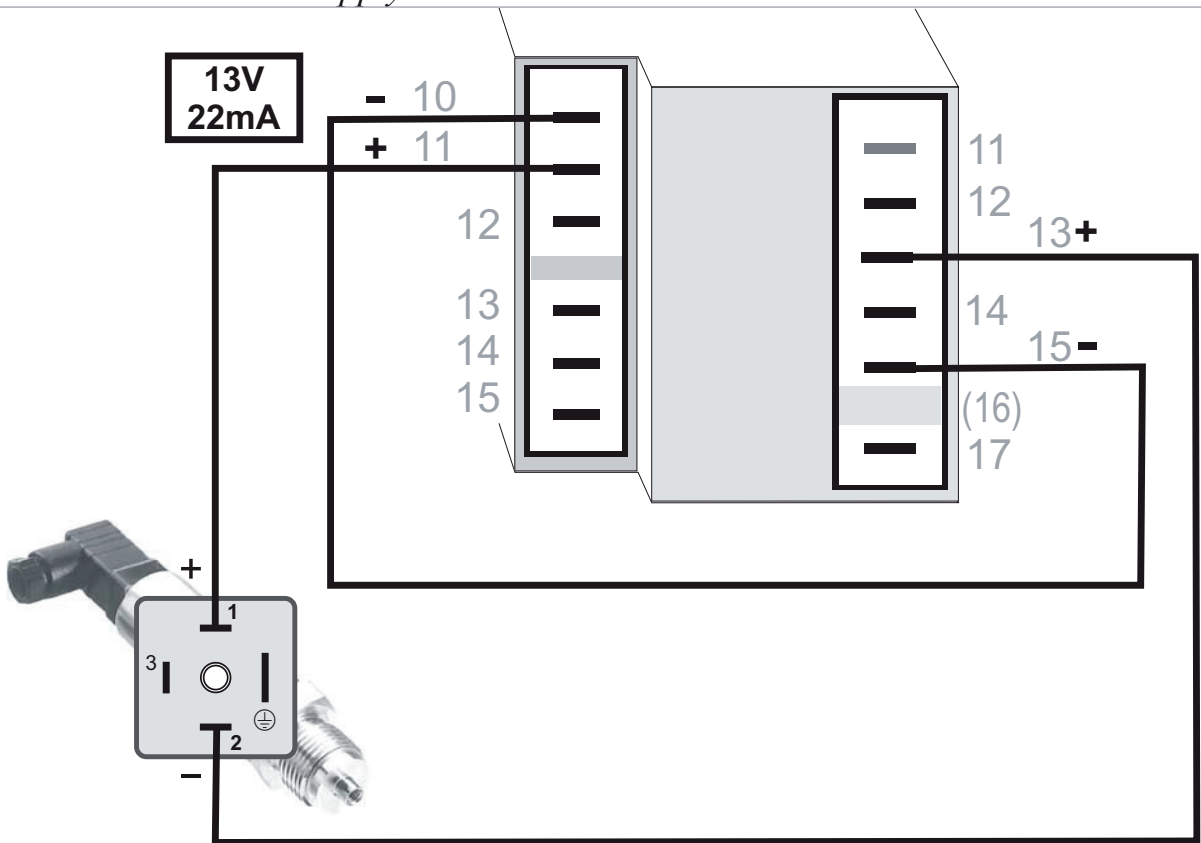

9 RS485 interface (with RS232-RS485 interface converter) *

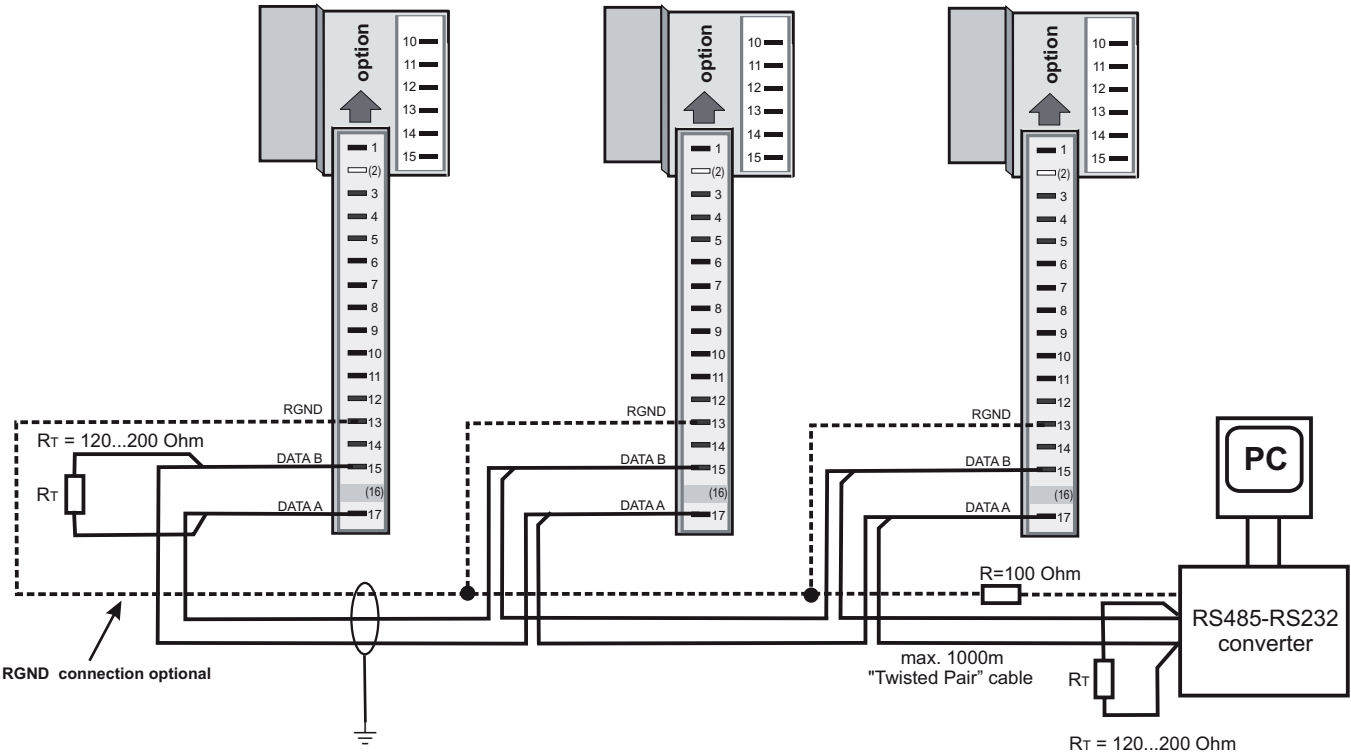


* Interface description Modbus RTU in separate manual: see page 72.



3 OUT3 as logic output with solid-state relay (series and parallel connection)



Parallel connection

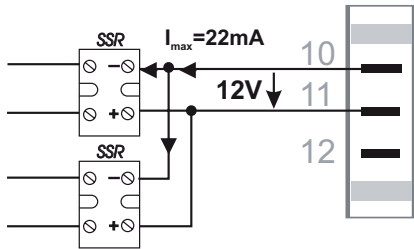


Series connection

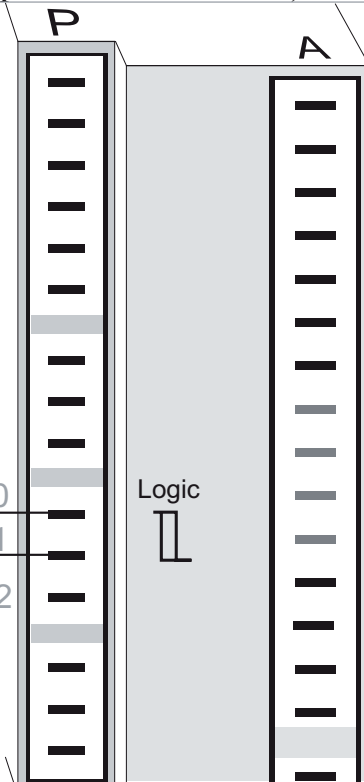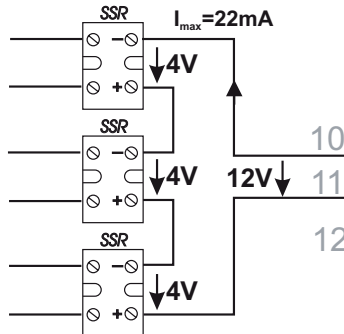

Anschlussbeispiel MIR-49x:


KS9x-1 connecting example:

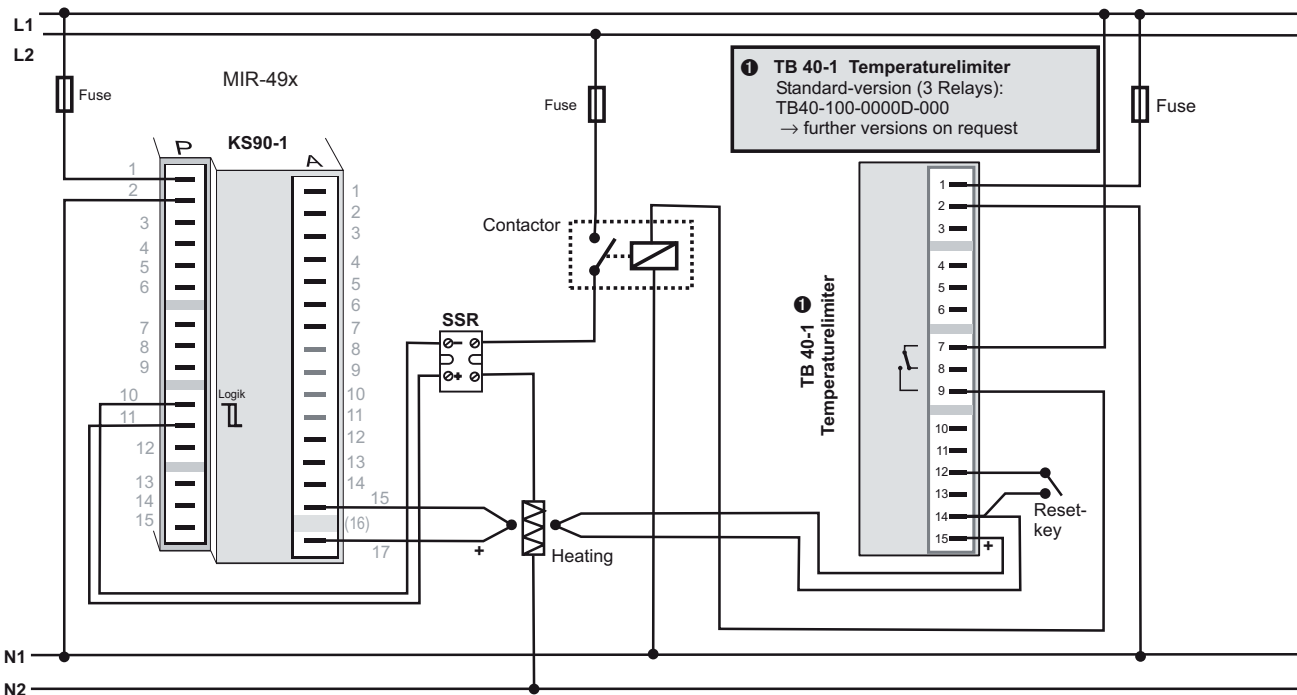

CAUTION: Using a temperature limiter is recommendable in systems where overtemperature implies a fire hazard or other risks.

3 Operation

3.1 Front view

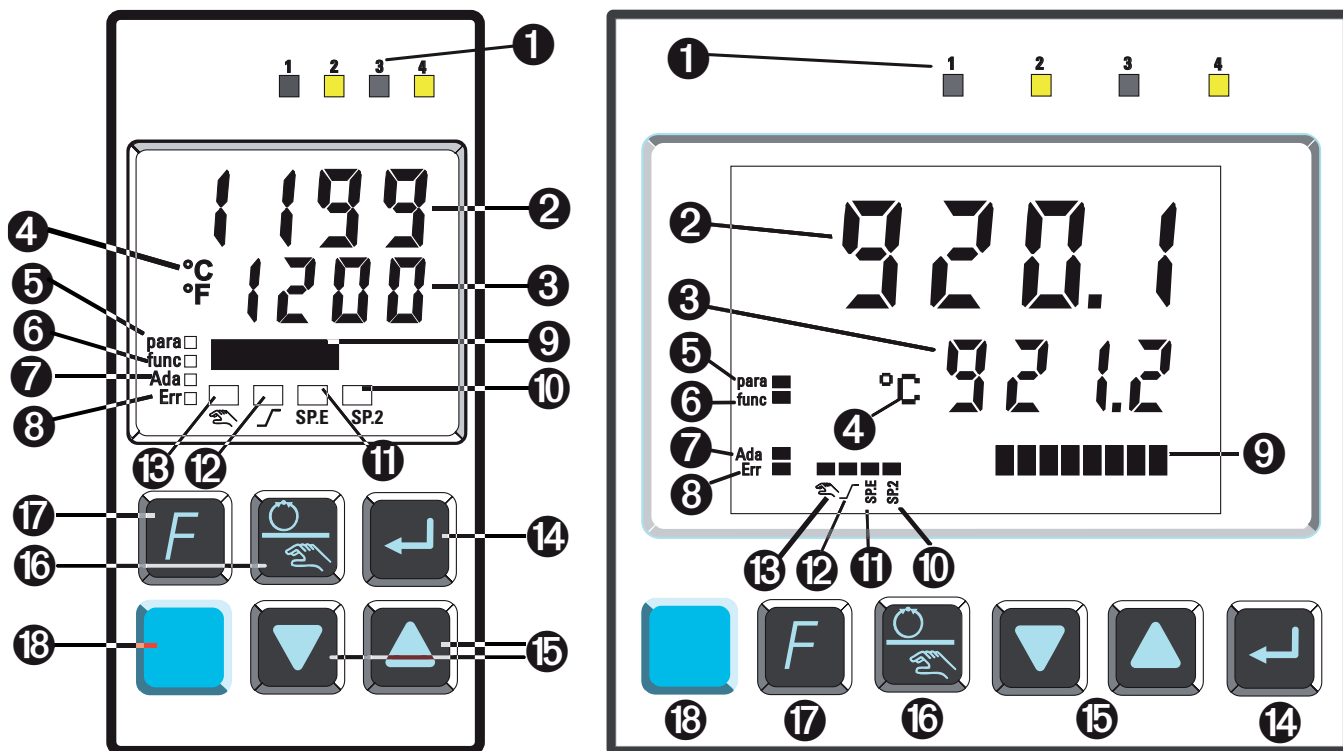

1	Statuses of switching outputs $Q_{out. 1 \dots 5}$	2	Process value display
3	Setpoint or correcting variable display	4	°C or °F display signalling
5	Signals $CONF$ - and $PARA$ level	6	Signals activated function key
7	Self-tuning active	8	Entry into the error list
9	Bargraph or plain text display	10	Setpoint $SP2$ is effective
11	Setpoint $SP1$ is effective	12	Setpoint gradient is effective
13	Manual-automatic switchover: Off: automatic On: manual mode (adjustment possible) <i>Blinks:</i> manual mode (adjustment not possible ($\rightarrow CONF/ENTER/ERR$))		
14	Enter key: call up extended operating level / error list		
15	Up/ down keys: changing setpoint or correcting variable		
16	automatic/manual or other functions ($\rightarrow CONF/LOGI$)		
17	freely configurable function key with pure controller operation		
18	PC connection for BlueControl (engineering tool)		

LED colours: LED 1, 2, 3, 4: yellow, Bargraph: red, other LEDs: red



In the upper display line, the process value is always displayed. At parameter, configuration, calibration as well as extended operating level, the bottom display line changes cyclically between parameter name and parameter value.

3.2 Behaviour after power-on


After supply voltage switch-on, the unit starts with the **operating level**.

The unit is in the condition which was active before power-off.


If the controller was in manual mode at supply voltage switch-off, the controller will re-start with the last output value in manual mode at power-on.

3.3 Operating level

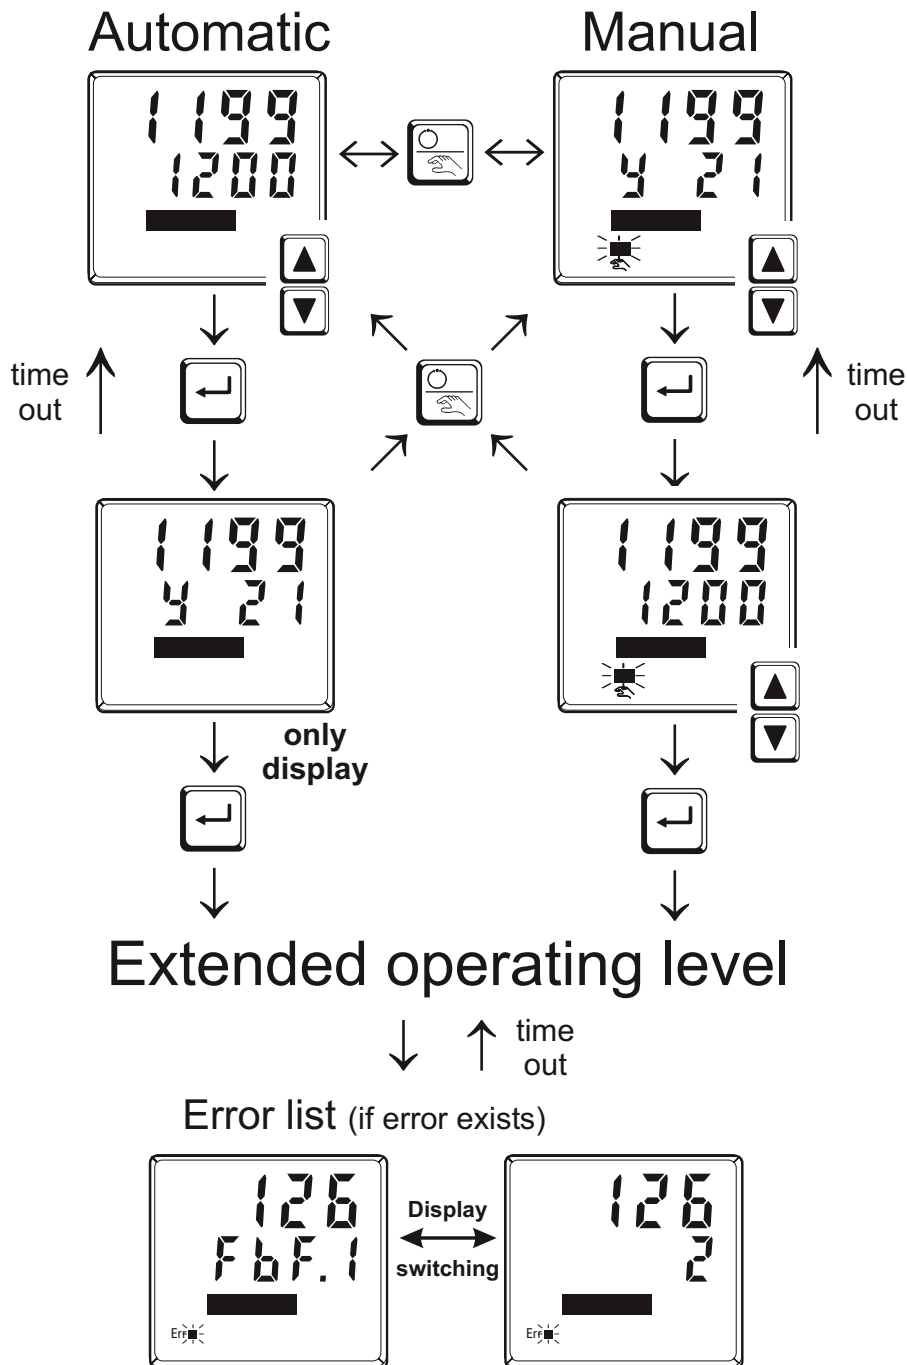

The content of the extended operating level is determined by means of BlueControl (engineering tool). Parameters which are used frequently or the display of which is important can be copied to the extended operating level.



3.4 Error list / Maintenance manager

With one or several errors, the extended operating level always starts with the error list. Signalling an actual entry in the error list (alarm, error) is done by the Err LED in the display. To reach the error list press  twice.



Err LED status	Signification	Proceed as follows
blinks (status 2)	Alarm due to existing error	- Determine the error type in the error list - After error correction the unit changes to status 1
lit (status 1)	Error removed, alarm not acknowledged	- Acknowledge the alarm in the error list pressing key  or  - The alarm entry was deleted (status 0).
off (status 0)	No error, all alarm entries deleted	- Not visible except when acknowledging

Error list:

Name	Description	Cause	Possible remedial action
E.1	Internal error, cannot be removed	- E.g. defective EEPROM	- Service kontaktieren - Gerät einschicken
E.2	Internal error, can be reset	- e.g. EMC trouble	- Keep measurement and power supply cables in separate runs - Ensure that interference suppression of contactors is provided
E.3	Configuration error, can be reset	- wrong configuration - missing configuration	- Service kontaktieren - configuration / parameters
E.4	Hardware error	- Codenumber and hardware are not identical	- Contact PMA service - Elektronik-/Optioncard must be exchanged
FbF. 1/2/3	Sensor break INP1/2/3	- Sensor defective - Faulty cabling	- Replace INP1/2/3 sensor - Check INP1/2/3 connection
Shk. 1/2/3	Short circuit INP1/2/3	- Sensor defective - Faulty cabling	- Replace INP1/2/3 sensor - Check INP1/2/3 connection
POL. 1/2/3	INP1/2/3 polarity error	- Faulty cabling	- Reverse INP1/2/3 polarity
HCA	Heating current alarm (HCA)	- Heating current circuit interrupted, $I < HCA$ or $I > HCA$ (dependent of configuration) - Heater band defective	- Check heating current circuit - If necessary, replace heater band

Name	Description	Cause	Possible remedial action
SSr	Heating current short circuit (SSR)	- Current flow in heating circuit with controller off - SSR defective	- Check heating current circuit - If necessary, replace solid-state relay
LoOP	Control loop alarm (LOOP)	- Input signal defective or not connected correctly - Output not connected correctly	- Check heating or cooling circuit - Check sensor and replace it, if necessary - Check controller and switching device
AdRH	Self-tuning heating alarm (ADAH)	- See Self-tuning heating error status	- see Self-tuning heating error status
AdRC	Self-tuning heating alarm cooling (ADAC)	- See Self-tuning cooling error status	- see Self-tuning cooling error status
dRE	DAC-Alarm	Actor error	see errorstatus DAC-function
L _{1/2/3}	stored limit alarm 1/2/3	- adjusted limit value 1/2/3 exceeded	- check process - Service kontaktieren
Inf.1	time limit value message	- adjusted number of operating hours reached	- application-specific
Inf.2	duty cycle message (digital outputs)	- adjusted number of duty cycles reached	- application-specific
E5	Internal error in DP module	self-test errorinternal communication interrupted	Switch on the instrument againContact PMA service
dP.1	No access by bus master	bus errorconnector problemno bus connection	Check cableCheck connectorCheck connections
dP.2	Faulty configuration	Faulty DP configuration telegram	Check DP configuration telegram in master
dP.3	Inadmissible parameter setting telegram sent	Faulty DP parameter setting telegram	Check DP parameter setting telegram in master
dP.4	No data communication	Bus errorAddress errorMaster stopped	Check cable connectionCheck addressCheck master setting



Saved alarms (Err-LED is lit) can be acknowledged and deleted with the digital input di1/2/3, the **[F]**-key or the **[Info]**-key.

Configuration, see page 37: **CONF / LOG1 / Error**



If an alarm is still valid that means the cause of the alarm is not removed so far (Err-LED blinks), then other saved alarms can not be acknowledged and deleted.

Self-tuning heating (AdRH) and cooling (AdRL) error status:

Error status	Description	Behaviour
0	No error	
3	Faulty control action	Re-configure controller (inverse ↔ direct)
4	No response of process variable	The control loop is perhaps not closed: check sensor, connections and process
5	Low reversal point	Increase (AdRH) max. output limiting $Y.H$, or decrease (AdRL) min. output limiting $Y.L$ o
6	Danger of exceeded set-point (parameter determined)	If necessary, increase (inverse) or reduce (direct) set-point
7	Output step change too small ($\Delta y > 5\%$)	Increase (AdRH) max. output limiting $Y.H$, or reduce (AdRL) min. output limiting $Y.L$ o
8	Set-point reserve too small	Acknowledgment of this error message leads to switch-over to automatic mode. If self-tuning shall be continued, increase set-point (invers), reduce set-point (direct) or decrease set-point range (→ $PARA / SELEP / SP.LO$ and $SP.H$,)

DAC function (dRL) error status:

Error status	Description	Behaviour
0	No error	
3	Output is blocked	Check the drive for blockage
4	Wrong method of operation	Wrong phasing, defect motor capacitor
5	Fail at Yp measurement	Check the connection to the Yp input
6	Calibration error	Manual calibration necessary

3.5 Self-tuning

For determination of optimum process parameters, self-tuning is possible.

After starting by the operator, the controller makes an adaptation attempt, whereby the process characteristics are used to calculate the parameters for fast line-out to the set-point without overshoot.

The following parameters are optimized when self-tuning:

Parameter set 1:

$Pb1$	- Proportional band 1 (heating) in engineering units [e.g. °C]
t_{i1}	- Integral time 1 (heating) in [s]→ only, unless set to OFF
t_{d1}	- Derivative time 1 (heating) in [s]→ only, unless set to OFF
t_{c1}	- Minimum cycle time 1 (heating) in [s]→ only, unless Adt0 was set to “no self-tuning” during configuration by means of BlueControl®.
$Pb2$	- Proportional band 2 (cooling) in engineering units [e.g. °C]
t_{i2}	- Integral time 2 (cooling) in [s]→ only, unless set to OFF
t_{d2}	- Derivative time 2 (cooling) in [s]→ only, unless set to OFF
t_{c2}	- Minimum cycle time 2 (cooling) in [s] → only, unless Adt0 was set to “no self-tuning” during configuration by means of BlueControl®.

Parameter set 2: analogous to parameter set 1 (see page 25)

3.5.1 Preparation for self-tuning

- Adjust the controller measuring range as control range limits. Set values $r_{n\underline{L}}$ and $r_{n\underline{H}}$ to the limits of subsequent control.
(Configuration→Controller→lower and upper control range limits)
 $[onf] \rightarrow [ntc] \rightarrow r_{n\underline{L}}$ and $r_{n\underline{H}}$
- Determine which parameter set shall be optimized.
-The instantaneously effective parameter set is optimized.
→ Activate the relevant parameter set (1 or 2).
- Determine which parameter set shall be optimized (see tables above).
- Select the self-tuning method
see chapter 3.5.3
-Step attempt after start-up
-Pulse attempt after start-up
-Optimization at the set-point

3.5.2 Optimization after start-up or at the set-point

The two methods are optimization after start-up and at the set-point. As control parameters are always optimal only for a limited process range, various methods can be selected dependent of requirements. If the process behaviour is very different after start-up and directly at the set-point, parameter sets 1 and 2 can be optimized using different methods. Switch-over between parameter sets dependent of process status is possible (see page).

Optimization after start-up: (see page 4)

Optimization after start-up requires a certain separation between process value and set-point. This separation enables the controller to determine the control parameters by evaluation of the process when lining out to the set-point.

This method optimizes the control loop from the start conditions to the set-point, whereby a wide control range is covered.

We recommend selecting optimization method “**Step attempt after start-up**” with $\text{t}_{\text{unE}} = 0$ first. Unless this attempt is completed successfully, we recommend a “**Pulse attempt after start-up**”.

Optimization at the set-point: (see page 18)

For optimizing at the set-point, the controller outputs a disturbance variable to the process. This is done by changing the output variable shortly. The process value changed by this pulse is evaluated. The detected process parameters are converted into control parameters and saved in the controller.

This procedure optimizes the control loop directly at the set-point. The advantage is in the small control deviation during optimization.

3.5.3 Selecting the method ($\text{t}_{\text{unE}} / \text{t}_{\text{unF}} / \text{t}_{\text{unE}}$)

Selection criteria for the optimization method:

	Step attempt after start-up	Pulse attempt after start-up	Optimization at the set-point
$\text{t}_{\text{unE}} = 0$	sufficient set-point reserve is provided		sufficient set-point reserve is not provided
$\text{t}_{\text{unE}} = 1$		sufficient set-point reserve is provided	sufficient set-point reserve is not provided
$\text{t}_{\text{unE}} = 2$	always step attempt after start-up		

Sufficient set-point reserve:

inverse controller: (with process value < set-point - (10% of $r_{\text{NH}} - r_{\text{NL}}$)

direct controller: (with process value > set-point + (10% of $r_{\text{NH}} - r_{\text{NL}}$)

3.5.4 Step attempt after start-up

Condition: $-E_{SP} = 0$ and sufficient set-point reserve provided
or $-E_{SP} = 2$

The controller outputs 0% correcting variable or Y_{min} and waits, until the process is at rest (see start-conditions on page 8).

Subsequently, a correcting variable step change to 100% is output.

The controller attempts to calculate the optimum control parameters from the process response. If this is done successfully, the optimized parameters are taken over and used for line-out to the set-point.

With a *3-point controller*, this is followed by “cooling”.

After completing the 1st step as described, a correcting variable of -100% (100% cooling energy) is output from the set-point. After successful determination of the “cooling parameters”, line-out to the set-point is using the optimized parameters.

3.5.5 Pulse attempt after start-up

Condition: $-E_{SP} = 1$ and sufficient set-point reserve provided.

The controller outputs 0% correcting variable or Y_{min} and waits, until the process is at rest (see start conditions page 8)

Subsequently, a short pulse of 100% is output ($Y=100\%$) and reset.

The controller attempts to determine the optimum control parameters from the process response. If this is completed successfully, these optimized parameters are taken over and used for line-out to the set-point.

With a *3-point controller*, this is followed by “cooling”.

After completing the 1st step as described and line-out to the set-point, correcting variable "heating" remains unchanged and a cooling pulse (100% cooling energy) is output **additionally**. After successful determination of the “cooling parameters”, the optimized parameters are used for line-out to the set-point.

3.5.6 Optimization at the set-point


Conditions:

- A sufficient set-point reserve is **not** provided at self-tuning start (see page 17).
- E_{SP} is 0 or 1
- With $S_{TRT} = 1$ configured and detection of a process value oscillation by more than $\pm 0,5\%$ of $(r_{nH} - r_{nL})$ by the controller, the control parameters are preset for process stabilization and the controller realizes an *optimization at the set-point* (see figure “Optimization at the set-point”).
- when the step attempt after power-on has failed
- with active gradient function ($PARA/SETP/r.SP \neq OFF$), the set-point gradient is started from the process value and there isn't a sufficient set-point reserve.

Optimization-at-the-set-point procedure:

The controller uses its instantaneous parameters for control to the set-point. In lined out condition, the controller makes a pulse attempt. This pulse reduces the correcting variable by max. 20% ❶, to generate a slight process value undershoot. The changing process is analyzed and the parameters thus calculated are recorded in the controller. The optimized parameters are used for line-out to the set-point.

Optimization at the set-point

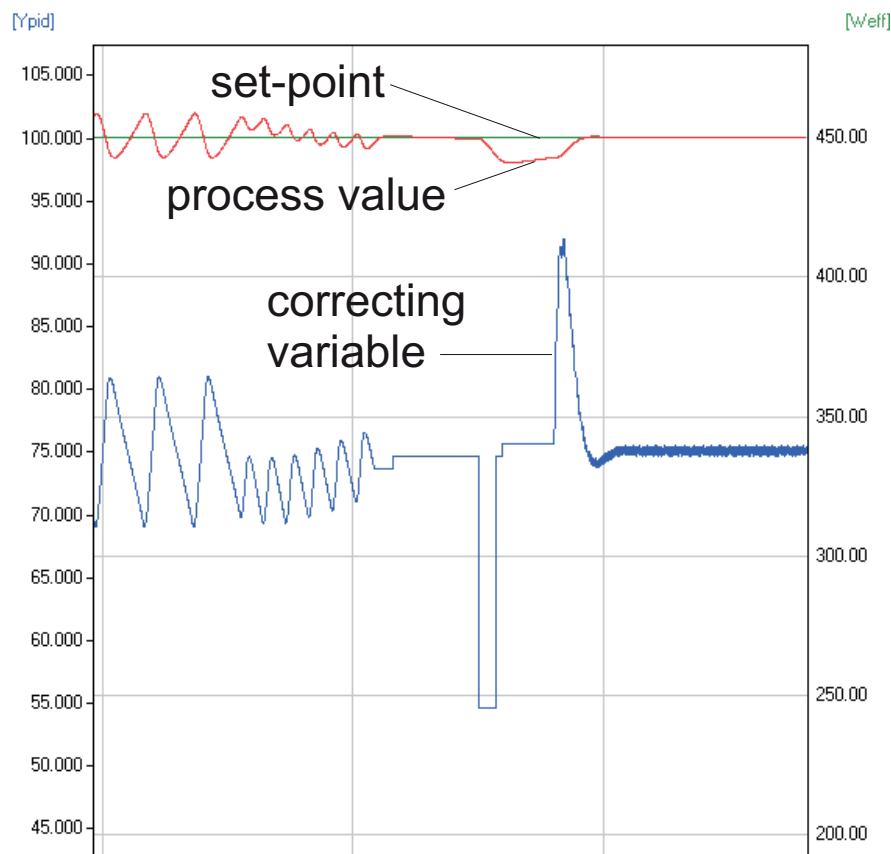


With a 3-point controller, optimization for the “heating“ or “cooling” parameters occurs dependent of the instantaneous condition. These two optimizations must be started separately.

❶ If the correcting variable is too low for reduction in lined out condition it is increased by max. 20%.

3.5.7 Optimization at the set-point for 3-point stepping controller

With 3-point stepping controllers, the pulse attempt can be made with or without position feedback. Unless feedback is provided, the controller calculates the motor actuator position internally by varying an integrator with the adjusted actuator travel time. For this reason, precise entry of the actuator travel time (t_t), as time between stops is highly important. Due to position simulation, the controller knows whether an increased or reduced pulse must be output. After supply voltage switch-on, position simulation is at 50%. When the motor actuator was varied by the adjusted travel time in one go, internal calculation occurs, i.e. the position corresponds to the simulation:

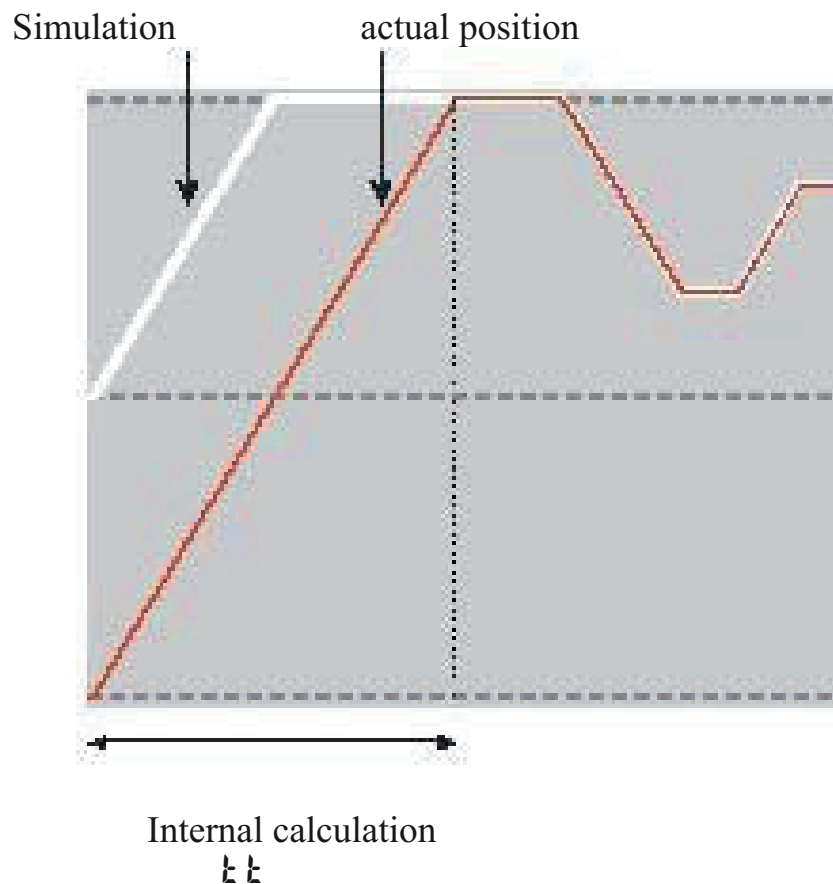

Internal calculation always occurs, when the actuator was varied by travel time t_t **in one go**, independent of manual or automatic mode. When interrupting the variation, internal calculation is cancelled. Unless internal calculation occurred already after self-tuning start, it will occur automatically by closing the actuator once.



Unless the positioning limits were reached within 10 hours, a significant deviation between simulation and actual position may have occurred. In this case, the controller would realize minor internal calculation, i.e. the actuator would be closed by 20 %, and re-opened by 20 % subsequently. As a result, the controller knows that there is a 20% reserve for the attempt.



3.5.8 Self-tuning start

Start condition:

- For process evaluation, a stable condition is required. Therefore, the controller waits until the process has reached a stable condition after self-tuning start.
The rest condition is considered being reached, when the process value oscillation is smaller than $\pm 0,5\%$ of $(r_{n\ddot{u}H} - r_{n\ddot{u}L})$.
- For self-tuning start after start-up, a 10% difference from $(SP_{LO} \dots SP_{HI})$ is required.

 Self-tuning start can be blocked via BlueControl® (engineering tool) (PLDC).

Start = 0 Only manual start by pressing keys  and  simultaneously or via interface is possible.



Start = 1 Manual start by press keys  and  simultaneously via interface and automatic start after power-on and detection of process oscillations.

Ada LED status	Signification
blinks	Waiting, until process calms down
lit	Self-tuning is running
off	Self-tuning not activ or ended



3.5.9 Self-tuning cancellation





By the operator:

Self-tuning can always be cancelled by the operator. For this, press  and  key simultaneously. With controller switch-over to manual mode after self-tuning start, self-tuning is cancelled. When self-tuning is cancelled, the controller will continue operating using the old parameter values.

By the controller:

If the Err LED starts blinking whilst self-tuning is running, successful self-tuning is prevented due to the control conditions. In this case, self-tuning was cancelled by the controller. The controller continues operating with the old parameters in automatic mode. In manual mode it continues with the old controller output value.

3.5.10 Acknowledgement procedures in case of unsuccessful self-tuning


1. Press keys  and  simultaneously:
The controller continues controlling using the old parameters in automatic mode. The Err LED continues blinking, until the self-tuning error was acknowledged in the error list.
2. Press key  (if configured):
The controller goes to manual mode. The Err LED continues blinking, until the self-tuning error was acknowledged in the error list.
3. Press key  :
Display of error list at extended operating level. After acknowledgement of the error message, the controller continues control in automatic mode using the old parameters.

Cancellation causes:


→ page 15: "Error status self-tuning heating (*AdRH*) and cooling (*AdRL*)"

3.5.11 Examples for self-tuning attempts (controller inverse, heating or heating/cooling)


Start: heating power switched on
 Heating power Y is switched off (1). When the change of process value X was constant during one minute (2), the power is switched on (3). At the reversal point, the self-tuning attempt is finished and the new parameter are used for controlling to set-point W.

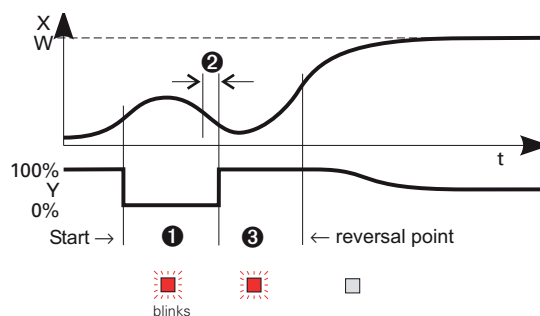


Start: heating power switched off
 The controller waits 1,5 minutes (1). Heating power Y is switched on (2). At the reversal point, the self-tuning attempt is finished and control to the set-point is using the new parameters.

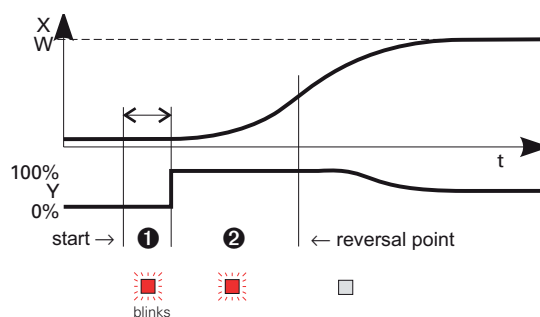

Self-tuning at the set-point ⚠
 The process is controlled to the set-point. With the control deviation constant during a defined time (1) (i.e. constant separation of process value and set-point), the controller outputs a reduced correcting variable pulse (max. 20%) (2). After determination of the control parameters using the process characteristic (3), control is started using the new parameters (4).

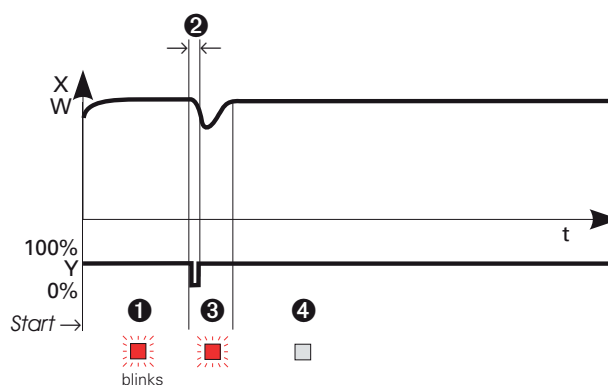

Three-point controller ⚠
 The parameter for heating and cooling are determined in two attempts. The heating power is switched on (1). Heating parameters P_{b1} , t_{i1} , t_{d1} and t_{i2} are determined at the reversal point. Control to the set-point occurs (2). With constant control deviation, the controller provides a cooling correcting variable pulse (3). After determining its cooling parameters P_{b2} , t_{i2} , t_{d2} and t_{i2} (4) from the process characteristics, control operation is started using the new parameters (5).

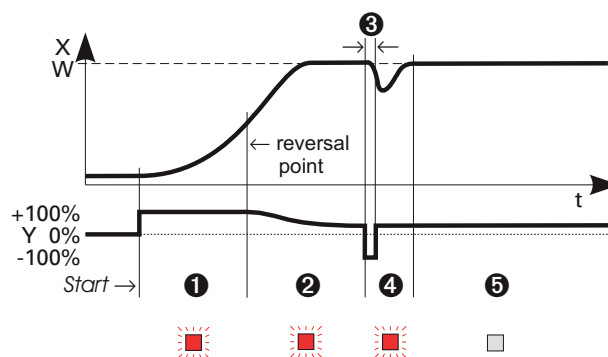


During phase 3, heating and cooling are done simultaneously!

3.6 Manual self-tuning

The optimization aid can be used with units on which the control parameters shall be set without self-tuning.

For this, the response of process variable x after a step change of correcting variable y can be used. Frequently, plotting the complete response curve (0 to 100%) is not possible, because the process must be kept within defined limits. Values T_g and x_{max} (step change from 0 to 100 %) or Δt and Δx (partial step response) can be used to determine the maximum rate of increase v_{max} .

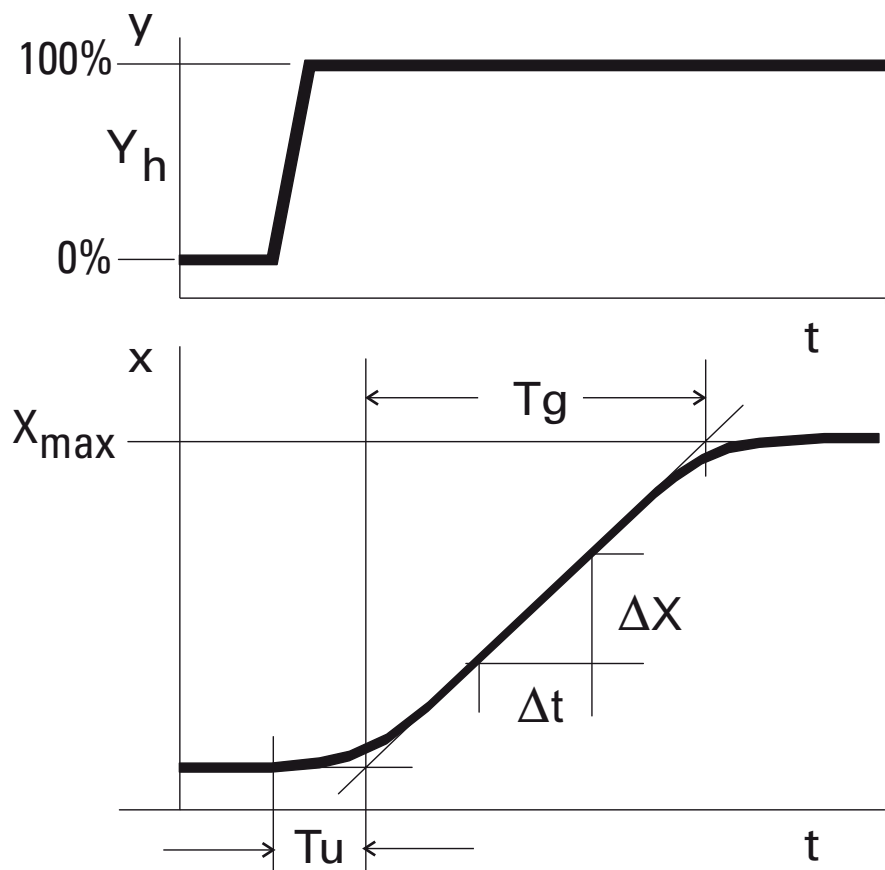

- y = correcting variable
- Y_h = control range
- T_u = delay time (s)
- T_g = recovery time (s)
- X_{max} = maximum process value

$$v_{max} = \frac{X_{max}}{T_g} = \frac{\Delta x}{\Delta t} \hat{=} \text{max. rate of increase of process value}$$

The control parameters can be determined from the values calculated for delay time T_u , maximum rate of increase v_{max} , control range X_h and characteristic K according to the **formulas** given below. Increase X_p , if line-out to the set-point oscillates.

Parameter adjustment effects

Parameter	Control	Line-out of disturbances	Start-up behaviour
P_b	higher	increased damping	slower line-out
	lower	reduced damping	faster line-out
t_d	higher	reduced damping	faster response to disturbances
	lower	increased damping	slower response to disturbances
t_i	higher	increased damping	slower line-out
	lower	reduced damping	faster line-out

Formulas

$$K = \frac{V_{max}}{T_u}$$

With 2-point and 3-point controllers, the cycle time must be adjusted to $t_i / t_d \leq 0,25 * T_u$

controller behavior	P_b [phy. units]	t_d [s]	t_i [s]
PID	$1,7 * K$	$2 * T_u$	$2 * T_u$
PD	$0,5 * K$	T_u	OFF
PI	$2,6 * K$	OFF	$6 * T_u$
P	K	OFF	OFF
3-point-stepping	$1,7 * K$	T_u	$2 * T_u$

3.7 Second PID parameter set

The process characteristic is frequently affected by various factors such as process value, correcting variable and material differences.

To comply with these requirements, KS 9x-1 can be switched over between two parameter sets.

Parameter sets $PAR.1$ and $PAR.2$ are provided for heating and cooling.

Dependent of configuration ($CONF/LOG/P id.2$), switch-over to the second parameter set ($CONF/LOG/P id.2$) is via one of digital inputs di1, di2, di3, key \boxed{F} or interface (OPTION).




Self-tuning is always done using the active parameter set, i.e. the second parameter set must be active for optimizing.


3.8 Alarm handling

Max. three alarms can be configured and assigned to the individual outputs. Generally, outputs $Out.1 \dots Out.6$ can be used each for alarm signalling. If more than one signal is linked to one output the signals are OR linked. Each of the 3 limit values $L_{in.1} \dots L_{in.3}$ has 2 trigger points $H.x$ (Max) and $L.x$ (Min), which can be switched off individually (parameter = "OFF"). Switching difference $HYS.x$ and delay $DEL.x$ of each limit value is adjustable.


① Operating principle absolut alarm
L.I = OFF

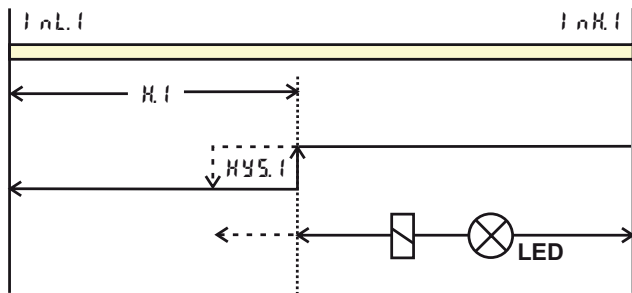




② Operating principle relative alarm
L.I = OFF

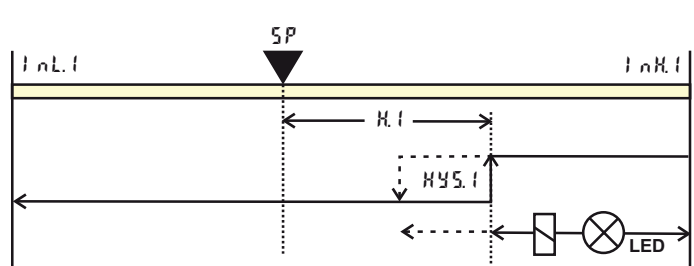

H.I = OFF

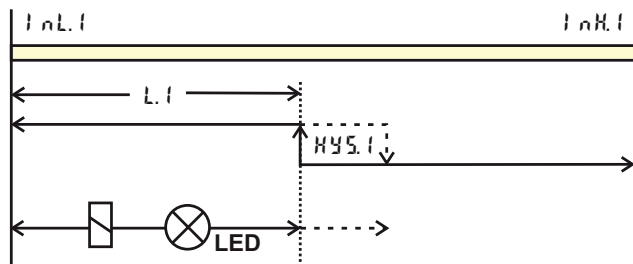


H.I = OFF

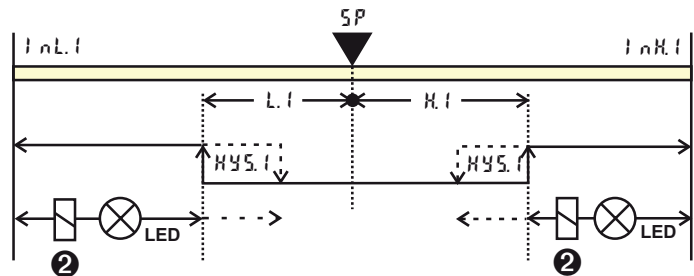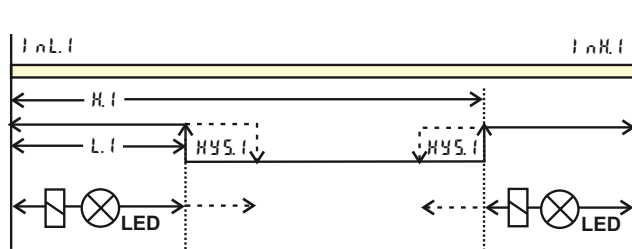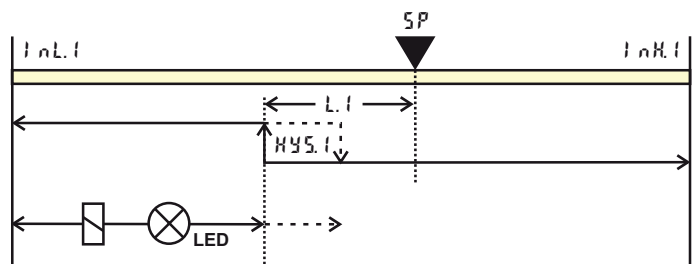


①: normally closed ($CONF/Out.x/React = 1$) (see examples in the drawing)

②: normally open ($CONF/Out.x/React = 0$)(inverted output relay action)

 The variable to be monitored can be selected separately for each alarm via configuration


The following variables can be monitored:

- process value
- control deviation x_w (process value - set-point)
- control deviation x_w + suppression after start-up or set-point change
 After switching on or set-point changing, the alarm output is suppressed, until the process value is within the limits for the first time. At the latest after expiration of time $10 \cdot t_{int}$, the alarm is activated. (t_{int} = integral time 1; parameter \rightarrow `INT1`)
 If t_{int} is switched off ($t_{int} = OFF$), this is interpreted as ∞ , i.e. the alarm is not activated, before the process value was within the limits once.
- Measured value INP1
- Measured value INP2
- Measured value INP3
- effective set-point W_{eff}
- correcting variable y (controller output)
- Deviation from SP internal
- $x_1 - x_2$
- control deviation x_w + suppression after start-up or setpoint change without time limit.
 - after switch-on or setpoint change, alarm output is suppressed, until the process value was within the limits once.

 If measured value monitoring + alarm status storage is chosen (`CONF / LINT / FNC.X = 2/4`), the alarm relay remains switched on until the alarm is reset in the error list (`LINT [..3] = 1`).

3.9 Operating structure

After supply voltage switch-on, the controller starts with the **operating levels**. The controller status is as before power off.

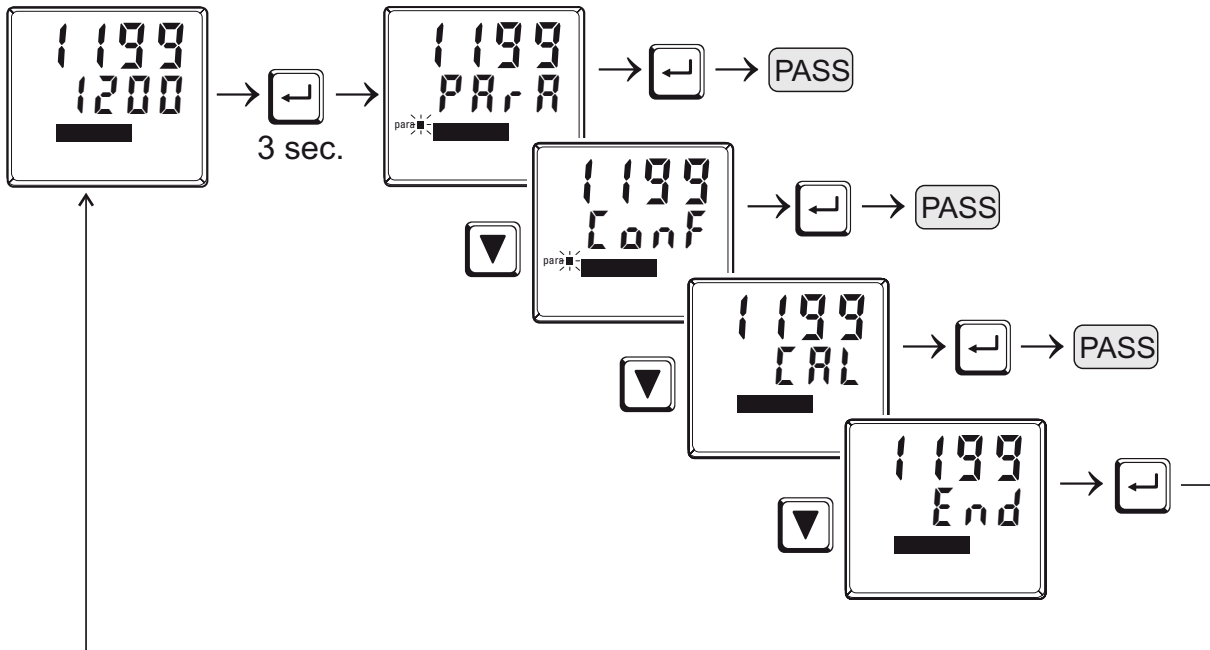

- i** **PArA** - level: At **PArA** - level, the right decimal point of the bottom display line is *lit continuously*.
- i** **Conf** - level: At **Conf** - level, the right decimal point of bottom display line *blinks*.

PASS

When safety switch **Loc** is open, only the levels enabled by means of BlueControl (engineering tool) are visible and accessible by entry of the password also adjusted by means of BlueControl (engineering tool). Individual parameters accessible without password must be copied to the extended operating level.

- i** All password-protected levels are disabled only, if the **Loc** safety switch is closed.
- i** Factory setting: Safety switch **Loc** closed: all levels accessible without restriction, password **PASS = OFF**.




Safety switch Loc	Password entered with BluePort®	Function disabled or enabled with BluePort®	Access via the instrument front panel:
closed	OFF / password	disabled / enabled	enabled
open	OFF / password	disabled	disabled
open	OFF	enabled	enabled
open	Password	enabled	enabled after password entry


4 Configuration level

4.1 Configuration survey

CONF Configuration level													
Enter Control and self-tuning	Input 1	Input 2	Input 3	Limit value functions	Output 1	Output 2	Output 3	Output 4	Output 5/6	Digital inputs	Display, operation, interface		
SPFn	IFnc	IFnc	IFnc	Fnc.1	ORct	See output 1	OUTP	OUTP	See output 1	Lrr	bRud		
EtYP	StYP	StYP	SL in	Src.1	Y.1		ORct	ORct		SP2	Addr		
EFnc	SL in	Corr	StYP	Fnc.2	Y.2		Out.0	Y.1		SPE	PrtY		
EdiF	Corr	InF	Corr	Src.2	L in.1		Out.1	Y.2		Y.2	dELy		
nRn	InF		InF	Fnc.3	L in.2		OSrc	L in.1		Y.E	dPRd		
ARct				Src.3	L in.3		OFRI	L in.2		nRn	bcuP		
FRIL				HCLAL	dRcR		Y.1	L in.3		COFF	02		
rngL				LPAL	LPAL		Y.2	dRcR		nLoc	Unit		
rngH				dRcR	HCLAL		L in.1	LPAL		Errr	dP		
YCL					HCLSC		L in.2	HCLAL		P id.2	LEd		
tunE					PEnd		L in.3	HCLSC		ICHG	dI SP		
StEt					FR v.1		dRcR	PEnd		d v.Fn	CdEL		
					FR v.2		LPAL	FR v.1					
					FR v.3	HCLAL	FR v.2						
					dPER	HCLSC	FR v.3						
						FR v.1	Out.0						
						FR v.2	Out.1						
						FR v.3	OSrc						
						dPER							

Adjustment:

- The configuration can be adjusted by means of keys   .
- Transition to the next configuration is by pressing key  .
- After the last configuration of a group, **dONE** is displayed and followed by automatic change to the next group

Return to the beginning of a group is by pressing the  key for 3 sec.

4.2 Configuration parameters

Ctrl

Name	Value range	Description	Default
SPEP		Basic configuration of setpoint processing	0
	0	set-point controller can be switched over to external set-point (->LOGI /SPE)	
	8	standard controller with external offset (SPE)	
CTYP		Calculation of the process value	0
	0	standard controller (process value = x1)	
	1	ratio controller (x1/x2)	
	2	difference (x1 - x2)	
	3	Maximum value of x1 and x2. It is controlled with the bigger value. At sensor failure it is controlled with the remaining actual value.	
	4	Minimum value of x1 and x2. It is controlled with the smaller value. At sensor failure it is controlled with the remaining actual value.	
	5	Mean value (x1, x2). With sensor error, controlling is continued with the remaining process value.	
	6	Switchover between x1 and x2 (->LOGI /ICHE)	
	7	O function with constant sensor temperature	
8	O function with measured sensor temperature		
CFnc		Control behaviour (algorithm)	1
	0	on/off controller or signaller with one output	
	1	PID controller (2-point and continuous)	
	2	Δ / Y / Off, or 2-point controller with partial/full load switch-over	
	3	2 x PID (3-point and continuous)	
	4	3-point stepping controller	
	5	3-point stepping controller with position feedback Yp	
6	continuous controller with integrated positioner		
CDIF		Output action of the PID controller derivative action	0
	0	Derivative action acts only on the measured value.	
	1	Derivative action only acts on the control deviation (set-point is also differentiated)	
MAN		Manual operation permitted	0
	0	no	
	1	yes (->LOGI /MAN)	
CRct		Method of controller operation	0
	0	inverse, e.g. heating The correcting variable increases with decreasing process value and decreases with increasing process value.	
	1	direct, e.g. cooling The correcting variable increases with increasing process value and decreases with decreasing process value.	

Name	Value range	Description	Default
FAIL		Behaviour at sensor break	1
	0	controller outputs switched off	
	1	y = Y2	
	2	y = mean output. The maximum permissible output can be adjusted with parameter $Y_{n.H}$. To prevent determination of inadmissible values, mean value formation is only if the control deviation is lower than parameter $L.Y_n$.	
rnGL	-1999...9999	X0 (start of control range) ❶	-100
rnGH	-1999...9999	X100 (end of control range) ❶	1200
CYCL		Characteristic for 2-point- and 3-point-controllers	0
	0	standard	
	1	water cooling linear (siehe Seite 45)	
	2	water cooling non-linear	
	3	with constant cycle	
tune		Auto-tuning at start-up	0
	0	At start-up with step attempt, at set-point with impulse attempt	
	1	At start-up and at set-point with impulse attempt. Setting for fast controlled systems (e.g. hot runner control)	
	2	Always step attempt at start-up	
Start		Start of auto-tuning	0
	0	Manual start of auto-tuning	
	1	Manual or automatic start of auto-tuning at power on or when oscillating is detected	
Adt0		Optimization of T1, T2 (only visible with BlueControl!)	0
	0	Automatic optimization	
	1	No optimization	

❶ rnGL and rnGH are indicating the range of control on which e.g. the self-tuning is referring

INP.1

Name	Value range	Description	Default
INPnc		INP1 function selection	7
	0	No function (following INP data are skipped)	
	1	Heating current input	
	2	External set-point $SP.E$ (switch-over -> $LOG1 / SP.E$)	
	3	Position feedback Y_p	
	4	Second process value x_2 (ratio, min, max, mean)	
	5	External positioning value $Y.E$ (switch-over -> $LOG1 / Y.E$)	
	6	No controller input (e.g. limit signalling instead)	
SEYP		Sensor type selection	1
	0	thermocouple type L (-100...900°C), Fe-CuNi DIN	
	1	thermocouple type J (-100...1200°C), Fe-CuNi	
	2	thermocouple type K (-100...1350°C), NiCr-Ni	
	3	thermocouple type N (-100...1300°C), Nicrosil-Nisil	

Name	Value range	Description	Default
	4	thermocouple type S (0...1760°C), PtRh-Pt10%	
	5	thermocouple type R (0...1760°C), PtRh-Pt13%	
	6	thermocouple type T (-200...400°C), Cu-CuNi	
	7	thermocouple type C (0...2315°C), W5%Re-W26%Re	
	8	thermocouple type D (0...2315°C), W3%Re-W25%Re	
	9	thermocouple type E (-100...1000°C), NiCr-CuNi	
	10	thermocouple type B (0/100...1820°C), PtRh-Pt6%	
	18	special thermocouple	
	20	Pt100 (-200.0 ... 100.0 °C) (-200,0 ... 150,0°C with reduced lead resistance: measuring resistance + lead resistance ≤ 160 Ω)	
	21	Pt100 (-200.0 ... 850.0 °C)	
	22	Pt1000 (-200.0 ... 850.0 °C)	
	23	special 0...4500 Ohm (preset to KTY11-6)	
	24	special 0...450 Ohm	
	30	0...20mA / 4...20mA ①	
	40	0...10V / 2...10V ①	
	41	special -2,5...115 mV ①	
	42	special -25...1150 mV ①	
	50	potentiometer 0...160 Ohm ①	
51	potentiometer 0...450 Ohm ①		
52	potentiometer 0...1600 Ohm ①		
53	potentiometer 0...4500 Ohm ①		
S.L in		Linearization (only at S.L YP = 23 (KTY 11-6), 24 (0...450 Ω), 30 (0...20mA), 40 (0...10V), 41 (0...100mV) and 42 (special -25...1150 mV))	0
	0	none	
	1	Linearization to specification. Creation of linearization table with BlueControl (engineering tool) possible. The characteristic for KTY 11-6 temperature sensors is preset.	
Corr		Measured value correction / scaling	0
	0	Without scaling	
	1	Offset correction (at CAL level) (controller offset adjustment is at CAL level)	
	2	2-point correction (at CAL level) (calibration is at the controller CAL level)	
	3	Scaling (at PAR level)	
	4	Autom. calibration (only with positionfeedback Yp)	
Inf	-1999...999 9	Alternative value for error at INP1 If a value is adjusted, this value is used for display and calculation in case of error (e.g. FAIL). ⚠ Before activating a substitute value, the effect in the control loop should be considered!	OFF
fAI1		Forcing INP1 (only visible with BlueControl!)	0
	0	No forcing	
	1	Forcing via serial interface	

① with current and voltage input signals, scaling is required (see chapter 5.3)

INP.2

Name	Value range	Description	Default
I.Fnc		Function selection of INP2	1
	0	no function (subsequent input data are skipped)	
	1	heating current input	
	2	external set-point (SPE)	
	3	Yp input	
	4	Second process value X2	
	5	External positioning value Y.E (switch-over → LOG1 / Y.E)	
	6	no controller input (e.g. transmitter input instead)	
S.EYP	7	Process value x1	
		Sensor type selection	30
	30	0...20mA / 4...20mA ①	
	31	0...50mA AC ①	
	50	Potentiometer (0...160 Ohm) ①	
	51	Potentiometer (0...450 Ohm) ①	
	52	Potentiometer (0...1600 Ohm) ①	
	53	Potentiometer (0...4500 Ohm) ①	
	L.corr		Measured value correction / scaling
0		Without scaling	
1		Offset correction (at CAL level) (offset entry is at controller CAL level)	
2		2-point correction (at CAL level) (calibration is at controller CAL level)	
I.n.F	3	Scaling (at PARR level)	
	-1999...999 9	Alternative value for error at INP2 If a value is adjusted, this value is used for display and calculation in case of error (e.g. FAIL). ⚠ Before activating a substitute value, the effect in the control loop should be considered!	OFF
fAI2		Forcing INP2 (only visible with BlueControl!)	0
	0	No forcing	
	1	Forcing via serial interface	

① with current and voltage input signals, scaling is required (see chapter 5.3)



INP.3

Name	Value range	Description	Default
I.Fnc		Function selection of INP3	1
	0	no function (subsequent input data are skipped)	
	1	heating current input	
	2	External set-point SPE (switch-over -> LOG1 / SPE)	
	3	Yp input	
	4	Second process value X2	
	5	External positioning value Y.E (switch-over → LOG1 / Y.E)	
	6	no controller input (e.g. transmitter input instead)	
	7	Process value x1	

Name	Value range	Description	Default
LIN		Linearization (only at $I_{SP} = 30(0..20mA)$ and $40(0..10V)$ adjustable)	0
	0	none	
	1	Linearization to specification. Creation of linearization table with BlueControl (engineering tool) possible. The characteristic for KTY 11-6 temperature sensors is preset.	
SP		Sensor type selection	30
	0	thermocouple type L (-100...900°C), Fe-CuNi DIN	
	1	thermocouple type J (-100...1200°C), Fe-CuNi	
	2	thermocouple type K (-100...1350°C), NiCr-Ni	
	3	thermocouple type N (-100...1300°C), Nicrosil-Nisil	
	4	thermocouple type S (0...1760°C), PtRh-Pt10%	
	5	thermocouple type R (0...1760°C), PtRh-Pt13%	
	6	thermocouple type T (-200...400°C), Cu-CuNi	
	7	thermocouple type C (0...2315°C), W5%Re-W26%Re	
	8	thermocouple type D (0...2315°C), W3%Re-W25%Re	
	9	thermocouple type E (-100...1000°C), NiCr-CuNi	
	10	thermocouple type B (0/100...1820°C), PtRh-Pt6%	
	18	special thermocouple	
	20	Pt100 (-200,0 ... 100,0 °C) (-200,0 ... 150,0°C with reduced lead resistance: measuring resistance + lead resistance $\leq 160 \Omega$)	
	21	Pt100 (-200,0 ... 850,0 °C)	
	22	Pt1000 (-200,0 ... 850,0 °C)	
	23	special 0...4500 Ohm (preset to KTY11-6)	
	24	special 0...450 Ohm	
	30	0...20mA / 4...20mA ①	
	41	special -2,5...115 mV ①	
	42	special -25...115 mV ①	
	50	potentiometer 0...160 Ohm ①	
51	potentiometer 0...450 Ohm ①		
52	potentiometer 0...1600 Ohm ①		
53	potentiometer 0...4500 Ohm ①		
CORR		Measured value correction / scaling	0
	0	Without scaling	
	1	Offset correction (at ERR level) (offset entry is at controller ERR level)	
	2	2-point correction (at ERR level) (calibration is at controller ERR level)	
	3	Scaling (at $PARA$ level)	
4	Automatic calibration (DAC)		
INF	-1999...999 9	Alternative value for error at INP3 If a value is adjusted, this value is used for display and calculation in case of error (e.g. FAIL). ⚠ Before activating a substitute value, the effect in the control loop should be considered!	OFF
fAI3		Forcing INP3 (only visible with BlueControl!)	0
	0	No forcing	
	1	Forcing via serial interface	

① with current and voltage input signals, scaling is required (see chapter 5.3)

L i m

Name	Value range	Description	Default
Func.1		Function of limit 1/2/3	1
Func.2	0	switched off	
Func.3	1	measured value monitoring	
	2	Measured value monitoring + alarm latch. A latched limit value can be reset via error list or via a digital input, or by pressing key  or  (-> L O G I / E r r o r)	
	3	signal change (change/minute)	
	4	signal change and storage (change/minute)	
Src.1		Source of Limit 1/2/3	1
Src.2	0	process value	
Src.3	1	control deviation xw (process value - set-point)	
	2	Control deviation Xw (=relative alarm) with suppression after start-up and setpoint change After switch-on or setpoint change, alarm output is suppressed, until the process value was within the limits once. At the latest after elapse of time $10 \times t_i$ the alarm is activated. (t_i = integral time I; parameter \rightarrow L n t r) t_i switched off ($t_i = 0$) is considered as ∞ , i.e. the alarm is not activated, until the process value was within the limits once.	
	3	measured value INP1	
	4	measured value INP2	
	5	measured value INP3	
	6	effective setpoint Weff	
	7	correcting variable y (controller output)	
	8	control variable deviation xw (actual value - internal setpoint) = deviation alarm to internal setpoint	
	9	difference x1 - x2 (utilizable e.g. in combination with process value function "mean value" for recognizing aged thermocouples)	
	11	Control deviation (=relative alarm) with suppression after start-up and setpoint change without time limit After switch-on or setpoint change, alarm output is suppressed, until the process was within the limits once.	
	HCLAL		Alarm heat current function (INP2)
	0	switched off	
	1	Overload short circuit monitoring	
	2	Break and short circuit monitoring	
LPAL		Monitoring of control loop interruption for heating (see page 69)	0
	0	switched off / inactive	
	1	LOOP alarm active. A loop alarm is output, unless the process value reacts accordingly after elapse of $2 \times t_i$ with $Y=100\%$. With $t_i=0$, the LOOP alarm is inactive.	
DALAL		DAC alarm function (see page 69)	0
	0	DAC alarm switched off / inactive	
	1	DAC alarm active	

Name	Value range	Description	Default
Hour	OFF...9999 99	Operating hours (only visible with BlueControl!)	OFF
Swit	OFF...9999 99	Output switching cycles (only visible with BlueControl!)	OFF

Out.1 and Out.2

Name	Value range	Description	Default
Out.1		Method of operation of output OUT1	0
	0	direct / normally open	
	1	inverse / normally closed	
Y.1 Y.2		Controller output Y1/Y2	1
	0	not active	
	1	active	
L.1.1 L.1.2 L.1.3		Limit 1/2/3 signal	0
	0	not active	
	1	active	
dP.A		Valve monitoring (DAC)	0
	0	not active	
	1	active	
L.P.A.L		Interruption alarm signal (LOOP)	0
	0	not active	
	1	active	
H.C.A.L		Heat current alarm signal	0
	0	not active	
	1	active	
H.C.S.C		Solid state relay (SSR) short circuit signal	0
	0	not active	
	1	active	
FA.1 FA.2 FA.3		INP1/ INP2 / INP3 error signal	0
	0	not active	
	1	active	
dP.E.r		PROFIBUS error	0
	0	not active	
	1	active: Profibus trouble, no communication with this instrument.	
fOut		Forcing OUT1 (only visible with BlueControl!)	0
	0	No forcing	
	1	Forcing via serial interface	

Configuration parameters Out.2 = Out.1 except for:

Default Y.1 = 0 Y.2 = 1

Out.3 and Out.4

Name	Value range	Description	Default
O.TYP		Signal type selection OUT3	0
	0	relay / logic (only visible with current/logic voltage)	
	1	0 ... 20 mA continuous (only visible with current/logic/voltage)	
	2	4 ... 20 mA continuous (only visible with current/logic/voltage)	
	3	0...10 V continuous (only visible with current/logic/voltage)	
	4	2...10 V continuous (only visible with current/logic/voltage)	
	5	transmitter supply (only visible without OPTION)	
O.ACT		Method of operation of output OUT3 (only visible when O.TYP=0)	1
	0	direct / normally open	
	1	inverse / normally closed	
O.SCL	-1999...9999	Scaling of the analog output for 0% (0/4mA or 0/2V, only visible when O.TYP=1..5)	0
O.SCL	-1999...9999	Scaling of the analog output for 100% (20mA or 10V, only visible when O.TYP=1..5)	100
O.SRC		Signal source of the analog output OUT3 (only visible when O.TYP=1..5)	1
	0	not used	
	1	controller output y1 (continuous)	
	2	controller output y2 (continuous)	
	3	process value	
	4	effective set-point Weff	
	5	control deviation xw (process value - set-point)	
	6	measured value position feedback Yp	
	7	measured value INP1	
	8	measured value INP2	
9	measured value INP3		
O.FAI		Failbehaviour, behaviour of the analog output, if the signal source (O.SRC) is disturbed.	0
	0	upscale	
	1	downscale	
Y1 Y2		Controller output Y1/Y2 (only visible when O.TYP=0)	0
	0	not active	
	1	active	
L.LN.1		Limit 1/2/3 signal (only visible when O.TYP=0)	1
L.LN.2	0	not active	
L.LN.3	1	active	
D.A.C.A		Valve monitoring (DAC) (only visible when O.TYP=0)	0
	0	not active	
	1	active	
L.P.AL		Interruption alarm signal (LOOP) (only visible when O.TYP=0) (Loop-Alarm)	0
	0	not active	
	1	active	

Name	Value range	Description	Default
H.C.A.L		Heating current alarm signal (only visible when O.TYP=0)	0
	0	not active	
	1	active	
H.C.S.C		Solid state relay (SSR) short circuit signal (only visible when O.TYP=0)	0
	0	not active	
	1	active	
FR .1		INP1/ INP2 / INP3 error (only visible when O.TYP=0)	1
FR .2	0	not active	
FR .3	1	active	
P.F.E.r		PROFIBUS error	0
	0	not active	
	1	active: Profibus trouble, no communication with this instrument.	
fOut		Forcing OUT3 (only visible with BlueControl!)	0
	0	No forcing	
	1	Forcing via serial interface	

Out.5/Out.6

Configuration parameters Out.2 = Out.1 except for: Default $4.1 = 0$ $4.2 = 0$

















Method of operation and usage of output Out.1 to Out.6:

Is more than one signal chosen active as source, those signals are OR-linked.

LOG

Name	Value range	Description	Default
L .r		Local / Remote switching (Remote: adjusting of all values by front keys is blocked)	0
	0	no function (switch-over via interface is possible)	
	1	always active	
	2	DI1 switches	
	3	DI2 switches (basic instrument or OPTION)	
	4	DI3 switches (only visible with OPTION)	
	5	<input type="checkbox"/> - key switches	
S.P.2		Switching to second setpoint S.P.2	0
	0	no function (switch-over via interface is possible)	
	2	DI1 switches	
	3	DI2 switches (only visible with OPTION)	
	4	DI3 switches (only visible with OPTION)	
	5	<input type="checkbox"/> - key switches	

Name	Value range	Description	Default
5PE		Switching to external setpoint 5PE	0
	0	no function (switch-over via interface is possible)	
	1	always active	
	2	DI1 switches	
	3	DI2 switches (only visible with OPTION)	
	4	DI3 switches (only visible with OPTION)	
	5	 - key switches	
Y2		Y/Y2 switching	0
	0	no function (switch-over via interface is possible)	
	2	DI1 switches	
	3	DI2 switches (only visible with OPTION)	
	4	DI3 switches (only visible with OPTION)	
	5	 - key switches	
	6	 - key switches	
YE		Switching to fixed control output YE	0
	0	no function (switch-over via interface is possible)	
	1	always activated (manual station)	
	2	DI1 switches	
	3	DI2 switches (only visible with OPTION)	
	4	DI3 switches (only visible with OPTION)	
	5	 - key switches	
6	 - key switches		
AMn		Automatic/manual switching	0
	0	no function (switch-over via interface is possible)	
	1	always activated (manual station)	
	2	DI1 switches	
	3	DI2 switches (only visible with OPTION)	
	4	DI3 switches (only visible with OPTION)	
	5	 - key switches	
6	 - key switches		
LoFF		Switching off the controller	0
	0	no function (switch-over via interface is possible)	
	2	DI1 switches	
	3	DI2 switches (only visible with OPTION)	
	4	DI3 switches (only visible with OPTION)	
	5	 - key switches	
	6	 - key switches	
hLoc		Blockage of hand function	0
	0	no function (switch-over via interface is possible)	
	2	DI1 switches	
	3	DI2 switches (only visible with OPTION)	
	4	DI3 switches (only visible with OPTION)	
	5	 - key switches	

Name	Value range	Description	Default
Errr		Reset of all error list entries	0
	0	no function (switch-over via interface is possible)	
	2	DI1 switches	
	3	DI2 switches (only visible with OPTION)	
	4	DI3 switches (only visible with OPTION)	
	5	 - key switches	
	6	 - key switches	
Prd2		Switching of parameter set (Pb, ti, td)	0
	0	no function (switch-over via interface is possible)	
	2	DI1 switches	
	3	DI2 switches (only visible with OPTION)	
	4	DI3 switches (only visible with OPTION)	
	5	 - key switches	
lchG		Switching of the actual process value between Inp1 and X2	0
	0	no function (switch-over via interface is possible)	
	2	DI1 switches	
	3	DI2 switches (only visible with OPTION)	
	4	DI3 switches (only visible with OPTION)	
	5	 - key switches	
diFn		Function of digital inputs (valid for all inputs)	0
	0	direct	
	1	inverse	
	2	toggle key function	
fDI1		Forcing di1/2/3 (only visible with BlueControl!)	0
fDI2	0	No forcing	
fDI3	1	Forcing via serial interface	

othr

Name	Value range	Description	Default
bAud		Baudrate of the interface (only visible with OPTION)	2
	0	2400 Baud	
	1	4800 Baud	
	2	9600 Baud	
	3	19200 Baud	
Addr	1...247	Address on the interace (only visible with OPTION)	1
Prty		Data parity on the interface (only visible with OPTION)	1
	0	no parity (2 stop bits)	
	1	even parity	
	2	odd parity	
	3	no parity (1 stopbit)	
dELY	0...200	Delay of response signal [ms] (only visible with OPTION)	0

Name	Value range	Description	Default
dPAd	0...126	Profibus address	126
bc.uP		Behaviour as backup controller (see page)	0
	0	No backup functionality	
	1	With backup functionality	
O2		Entering parameter for O in ppm or %	0
	0	Parameter for O-function in ppm	
	1	Parameter for O-function in %	
Unit		Unit	1
	0	without unit	
	1	°C	
	2	°F	
dP		Decimal point (max. number of digits behind the decimal point)	0
	0	no digit behind the decimal point	
	1	1 digit behind the decimal point	
	2	2 digits behind the decimal point	
	3	3 digits behind the decimal point	
LEd		Function allocation of status LEDs 1 / 2 / 3 / 4	0
	10	OUT1, OUT2, OUT3, OUT4	
	11	Heating, alarm 1, alarm 2, alarm 3	
	12	Heating, cooling, alarm 1, alarm 2	
	13	Cooling, heating, alarm 1, alarm 2	
	14	Bus error	
dISP	0...10	Display luminosity	5
CDL	0..200	Modem delay [ms] Additional delay time, before the received message is evaluated in the Modbus. This time is required, unless messages are transferred continuously during modem transmission.	0
FrEq		Switching 50 Hz / 60 Hz (only visible with BlueControl!)	0
	0	50 Hz	
	1	60 Hz	
MAst		Modbus master/slave (see page) (visible only with BlueControl)	0
	0	No	
	1	Yes	
CycL	0...240	Master cycle (sec.) (see page) (visible only with BlueControl !)	120
AdrO	-32768...32767	Destination address (see page) (visible only with BlueControl!)	1100
AdrU	-32768...32767	Source address (see page) (visible only with BlueControl!)	1100
Numb	0...100	Number of data (see page) (visible only with BlueControl!)	1
ICof		Block controller off (only visible with BlueControl!)	0
	0	Released	
	1	Blocked	
IAda		Block auto tuning (only visible with BlueControl!)	0
	0	Released	
	1	Blocked	

Name	Value range	Description	Default
IExo		Block extended operating level (only visible with BlueControl!)	0
	0	Released	
	1	Blocked	
ILat		Suppression error storage (visible only with BlueControl!)	0
	0	No: error message remain in the error list until acknowledgement.	
	1	Yes alarms are deleted from the error list as soon as corrected	
Pass	OFF...9999	Password (only visible with BlueControl!)	OFF
IPar		Block parameter level (only visible with BlueControl!)	0
	0	Released	
	1	Blocked	
ICnf		Block configuration level (only visible with BlueControl!)	0
	0	Released	
	1	Block	
ICal		Block calibration level (only visible with BlueControl!)	0
	0	Released	
	1	Blocked	
CDis3		Display 3 controller operating level (only visible with BlueControl!)	2
	0	No value / only text	
	1	Display of value	
	2	Output value as bargraph	
	3	Control deviation as bargraph	
	4	Process value as bargraph	
TDis3	2...60	Display 3 display alternation time [s] (only visible with BlueControl!)	10
T.dis3	8 Zeichen	Text display 3 (only visible with BlueControl!)	
T.InF1	8 Zeichen	Text Inf.1 (only visible with BlueControl!)	
T.InF2	8 Zeichen	Text Inf.2 (only visible with BlueControl!)	

L in (only visible with BlueControl®)

Name	Value range	Description	Default
L in		Linearization for inputs INP1 or INP3 Access to this table is always with selection special thermocouple for INP.1 or INP.3 or with setting S.L in = 1 : special linearization for linearization. Default: KTY 11-6 (0...4,5 kOhm)	
U.L inE		Unit of linearization table	0
	0	No unit	
	1	In Celsius [°C]	
	2	In Fahrenheit [°C]	
I n.1	-999.0...99999	Input value 1 The signal is in [µV] or in [Ω] dependent of input type	1036
O u.1	0,001...9999	Output value 1 Signal assigned to I n.1	-49,94


Name	Value range	Description	Default
Input 2	-999.0...99999	Input value 2 The signal is in [μ V] or in [Ω] dependent of input type	1150
Output 2	0,001...9999	Output value 2 Signal assigned to Input 2	-38,94
⋮	⋮	⋮	⋮
Input 16	-999.0...99999	Input value 16 The signal is in [μ V] or in [Ω] dependent of input type	4470
Output 16	0,001...9999	Output value 16 Signal assigned to Input 16	150,0

3 engineering tools with different functionality facilitating the devices configuration and parameter setting are available (see chapter 10: Accessory equipment with ordering information). In addition to configuration and parameter setting, the engineering tools are used for data acquisition and offer long-term storage and print functions. The engineering tools are connected to the device via the front-panel interface „BluePort,, by means of PC (Windows 95 / 98 / NT) and a PC adaptor.

Description BlueControl: see chapter 9: BlueControl (page 71)

4.3 Set-point processing

The set-point processing structure is shown in the following picture:

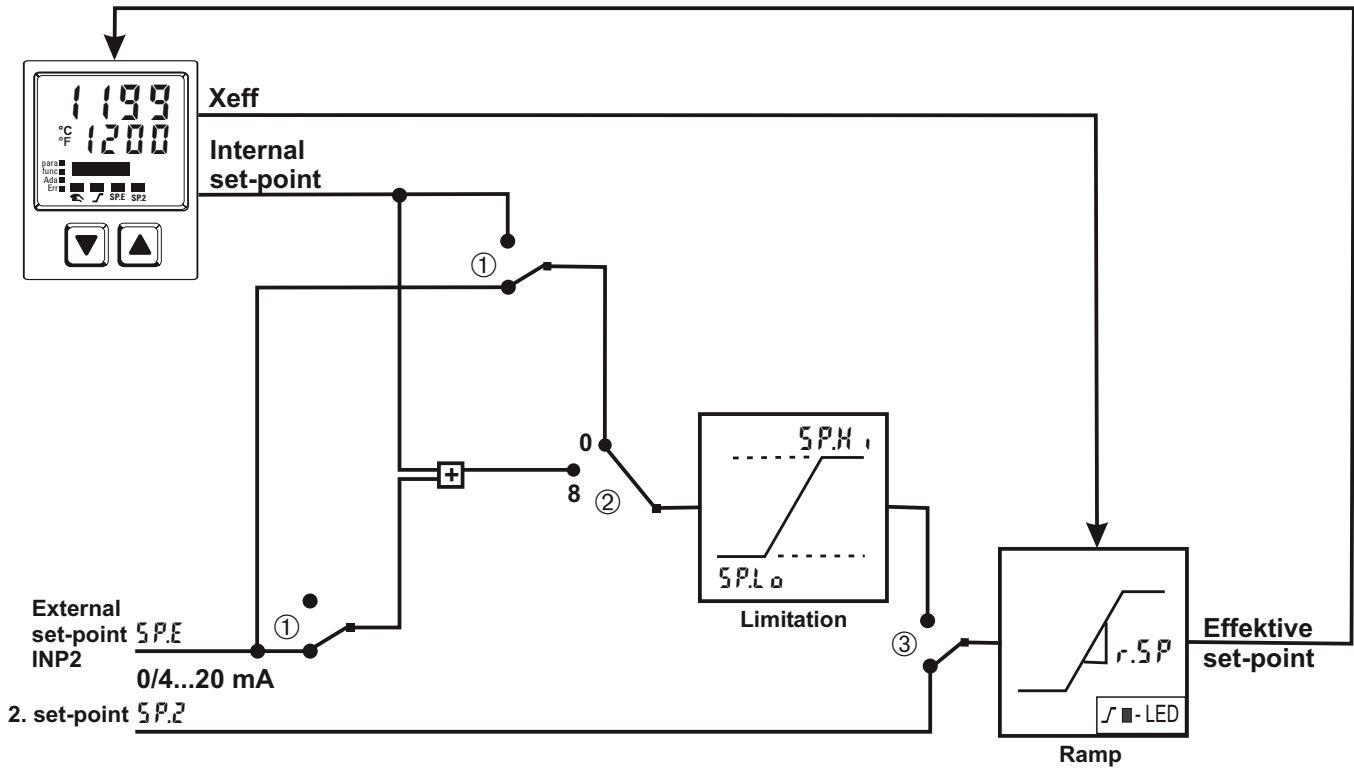

Index:

- ① : int/ext-setpoint switching
- ② : configuration $SP.F_n$
- ③ : $SP / SP.2$ switching

The ramp starts at process value with the following switchings:

- int / ext-setpoint switching
- $SP / SP.2$ switching
- Manual-/ Automatic switching
- at power on

4.3.1 Set-point gradient / ramp

To prevent setpoint step changes, a maximum rate of change is adjustable for parameter \rightarrow setpoint $\rightarrow r.SP$. This gradient acts both in positive and negative direction.


With parameter $r.SP$ set to **OFF** as in the factory setting, the gradient is switched off and setpoint changes are made directly.

4.4 Switching behaviuor

With these controllers, configuration parameter $CYCL$ ($CONF/ENTER/CYCL$) can be used for matching the cycle time of 2-point and 3-point controllers. This can be done using the following 4 methods.

4.4.1 Standard ($CYCL = 0$)

The adjusted cycle times t_1 and t_2 are valid for 50% or -50% correcting variable. With very small or very high values, the effective cycle time is extended to prevent unreasonably short on and off pulses. The shortest pulses result from $\frac{1}{4} \times t_1$ or $\frac{1}{4} \times t_2$. The characteristic curve is also called “bath tub curve”

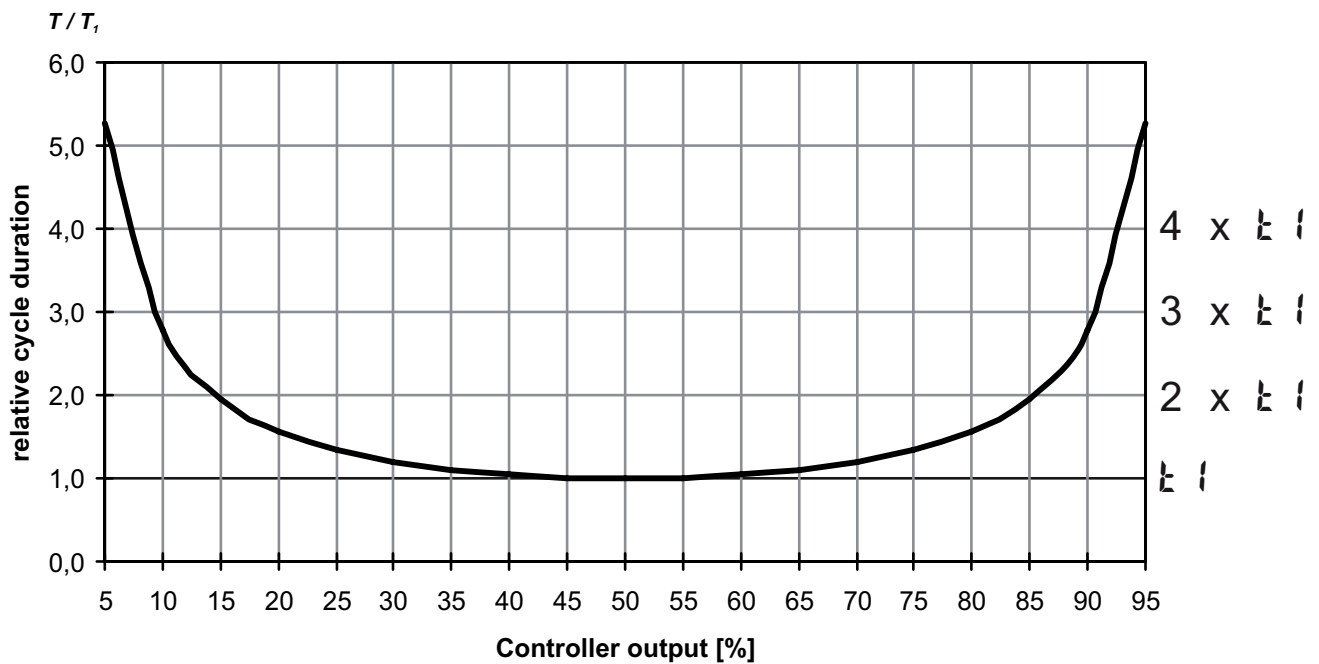

Parameters to be adjusted: t_1 : min. cycle time 1 (heating) [s]
 ($PARA/ENTER$) t_2 : min. cycle time 2 (cooling) [s]

4.4.2 Switching attitude linear ($CYCL = 1$)



For heating (Y_1), the standard method (see chapter 4.4.1) is used. For cooling (Y_2), a special algorithm for cooling with water is used. Generally, cooling is enabled only at an adjustable process temperature ($EM20$), because low temperatures prevent evaporation with related cooling, whereby damage to the plant is avoided. The cooling pulse length is adjustable using parameter t_{on} and is fixed for all output values.

The “off” time is varied dependent of output value. Parameter t_{off} is used for determining the min “off” time. For output of a shorter off pulse, this pulse is suppressed, i.e. the max. effective cooling output value is calculated according to formula $t_{on} / (t_{on} + t_{off}) \cdot 100\%$.

Parameters to be adjusted: $EM20$: minimum temperature for water cooling
 ($PARA/ENTER$) t_{on} : pulse duration water cooling
 t_{off} : minimum pause water cooling

4.4.3 Switching attitude non-linear ($\tau_{YCL} = 2$)


With this method, the cooling power is normally much higher than the heating power, i.e. the effect on the behaviour during transition from heating to cooling may be negative. The cooling curve ensures that the control intervention with 0 to -70% correcting variable is very weak. Moreover, the correcting variable increases very quickly to max. possible cooling. Parameter F_{K20} can be used for changing the characteristic curve. The standard method (see section 4.4.1) is also used for heating. Cooling is also enabled dependent of process temperature .

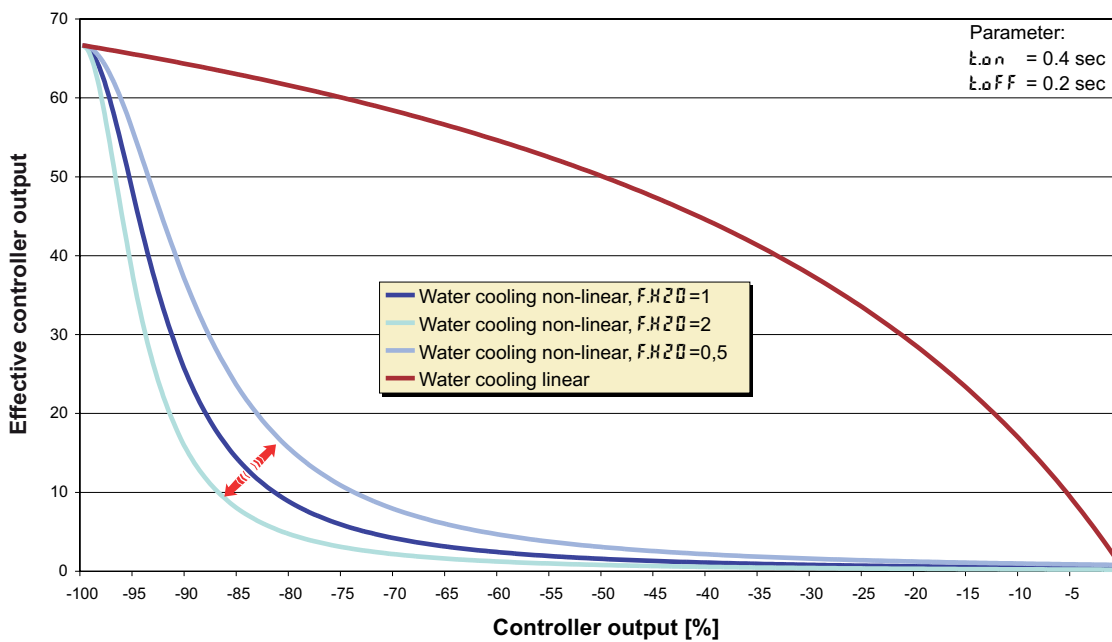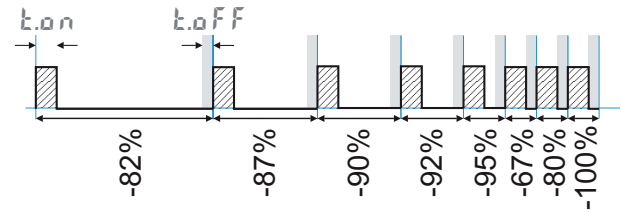

- Parameters to be adjusted:** F_{K20} : adaptation of (non-linear) characteristic
 (P_{ARR} / τ_{ntr}) Water cooling
- t_{on} : Pulse duration water cooling
 t_{off} : min. pause water cooling
 F_{K20} : min. temperature for water cooling

4.4.4 Heating and cooling with constant period ($\tau_{1/2} = 3$)

τ_1 and τ_2 are met in the overall output range. To prevent unreasonably short pulses, parameter τ_P is used for adjusting the shortest pulse duration. With small correcting values which require a pulse shorter than the value adjusted in τ_P , this pulse is suppressed. However, the controller stores the pulse and totalizes further pulses, until a pulse of duration τ_P can be output.

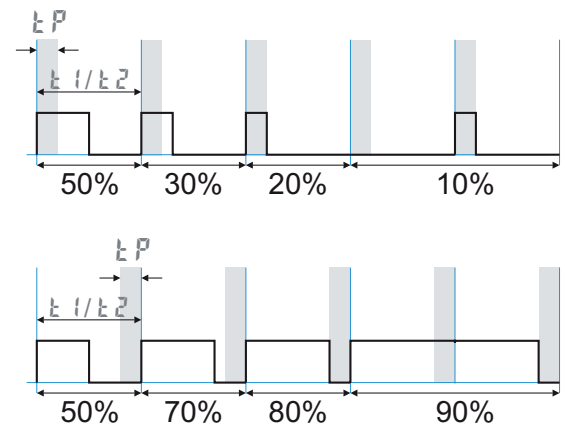


Parameters to be adjusted:
(τ_1, τ_2, τ_P)

- τ_1 : Min. cycle time 1 (heating) [s]
- τ_2 : min. cycle time 2 (cooling) [s]
- τ_P : min. pulse length [s]


4.5 Configuration examples

4.5.1 On-Off controller / Signaller (inverse)

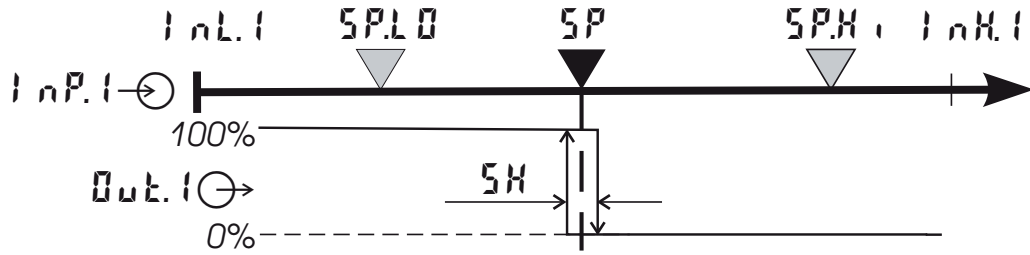


CONF / ENTR:	SPFn	= 0	set-point controller
	CFnc	= 0	signaller with one output
	CRct	= 0	inverse action (e.g. heating applications)
CONF / OUT.1:	ORct	= 0	action Out.1 direct
	Y1	= 1	control output Y1 active
PRrA / ENTR:	HYS.L	= 0...9999	switching difference below SP
PRrA / ENTR:	HYS.H	= 0...9999	switching difference above SP
PRrA / SEtP:	SP.L0	= -1999...9999	set-point limit low for Weff
	SP.H0	= -1999...9999	set-point limit high for Weff

i For direct signaller action, the controller action must be changed (CONF / ENTR / CRct = 1)

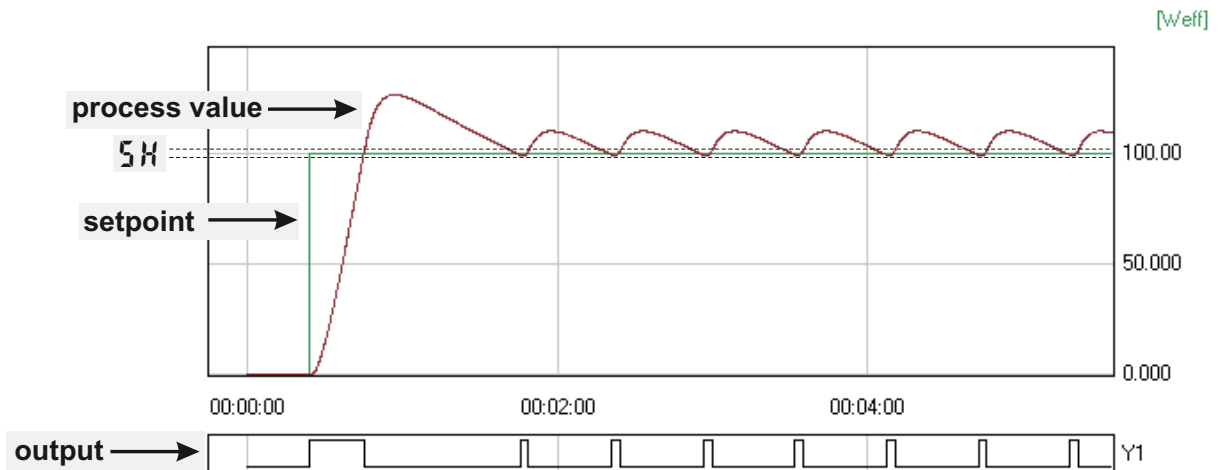


4.5.2 2-point controller (inverse)

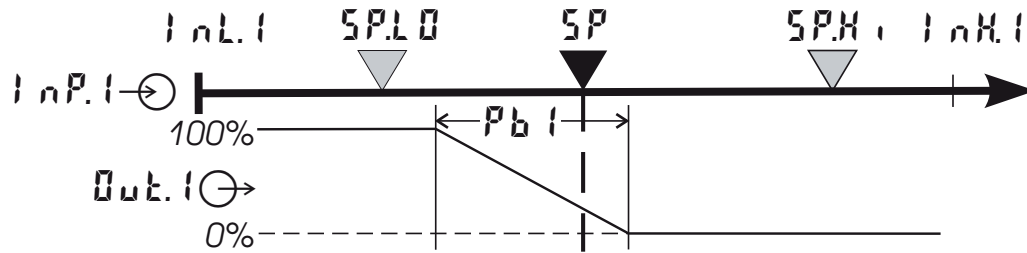


CONF / Contr:	SPFn = 0	set-point controller
	CFnc = 1	2-point controller (PID)
	CAct = 0	inverse action
		(e.g. heating applications)
CONF / Out.1:	OAct = 0	action Out.1 direct
	Y1 = 1	control output Y1 active
PARA / Contr:	Pb1 = 1...9999	proportional band 1 (heating)
		in units of phys. quantity (e.g. °C)
	t11 = 0,1...9999	integral time 1 (heating) in sec.
	td1 = 0,1...9999	derivative time 1 (heating) in sec.
	t1 = 0,4...9999	min. cycle time 1 (heating)
PARA / SEtP:	SP.L0 = -1999...9999	set-point limit low for Weff
	SP.H, = -1999...9999	set-point limit high for Weff

i For direct action, the controller action must be changed (CONF / Contr / CAct = 1).

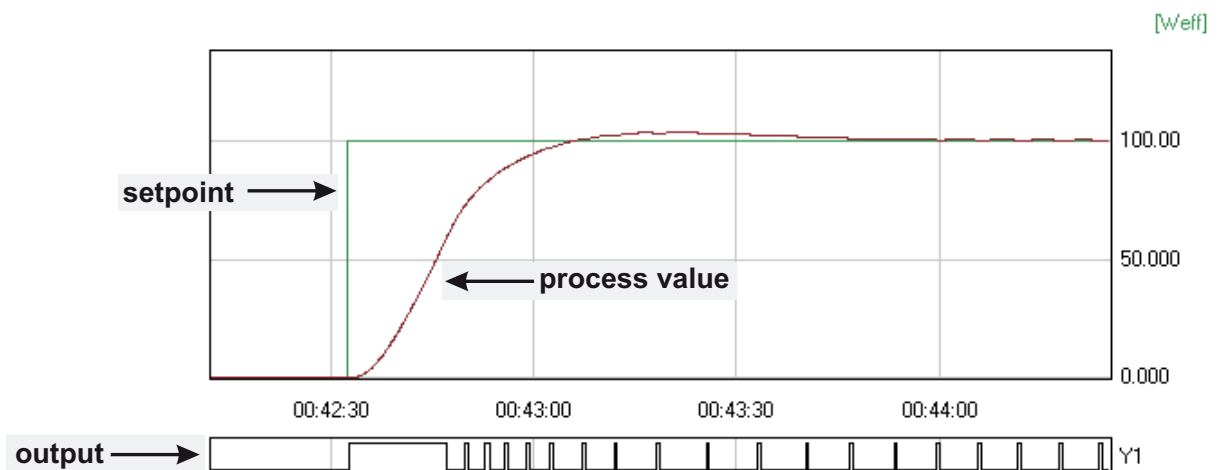


4.5.3 3-point controller (relay & relay)

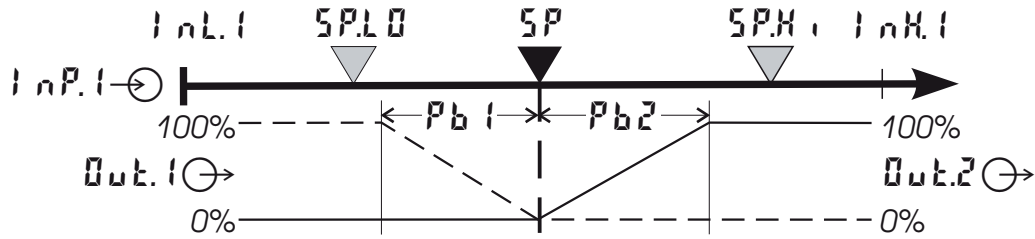


CONF / CONTR:	SPFn	= 0	set-point controller
	CFnc	= 3	3-point controller (2xPID)
	CAct	= 0	action inverse (e.g. heating applications)
CONF / Out.1:	ORct	= 0	action Out.1 direct
	y1	= 1	control output Y1 active
	y2	= 0	control output Y2 not active
CONF / Out.2:	ORct	= 0	action Out.2 direct
	y1	= 0	control output Y1 not active
	y2	= 1	control output Y2 active
PARA / CONTR:	Pb1	= 1...9999	proportional band 1 (heating) in units of phys. quantity (e.g. °C)
	Pb2	= 1...9999	proportional band 2 (cooling) in units of phys. quantity (e.g. °C)
	t11	= 0,1...9999	integral time 1 (heating) in sec.
	t12	= 0,1...9999	derivative time 2 (cooling) in sec.
	td1	= 0,1...9999	integral time 1 (heating) in sec.
	td2	= 0,1...9999	derivative time 2 (cooling) in sec.
	t1	= 0,4...9999	min. cycle time 1 (heating)
	t2	= 0,4...9999	min. cycle time 2 (cooling)
	SK	= 0...9999	neutr. zone in units of phys.quantity
PARA / SEtP:	SP.LO	= -1999...9999	set-point limit low for Weff
	SP.HI	= -1999...9999	set-point limit high for Weff

4.5.4 3-point stepping controller (relay & relay)

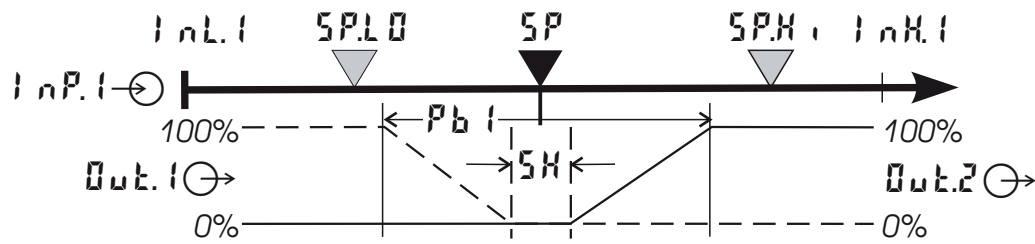


CONF / Contr:	SPFn = 0	set-point controller
	CFnc = 4	3-point stepping controller
	CAct = 0	inverse action
		(e.g. heating applications)
CONF / Out.1:	ORAct = 0	action Out.1 direct
	Y1 = 1	control output Y1 active
	Y2 = 0	control output Y2 not active
CONF / Out.2:	ORAct = 0	action Out.2 direct
	Y1 = 0	control output Y1 not active
	Y2 = 1	control output Y2 active
PRrR / Contr:	Pb1 = 1...9999	proportional band 1 (heating) in units of phys. quantity (e.g. °C)
	t i 1 = 0,1...9999	integral time 1 (heating) in sec.
	t d 1 = 0,1...9999	derivative time 1 (heating) in sec.
	t 1 = 0,4...9999	min. cycle time 1 (heating)
	SH = 0...9999	neutral zone in units of phys. quantity
	tP = 0,1...9999	min. pulse length in sec.
	t t = 3...9999	actuator travel time in sec.
PRrR / SEtP:	SP.L0 = -1999...9999	set-point limit low for Weff
	SP.H1 = -1999...9999	set-point limit high for Weff

i For direct action of the 3-point stepping controller, the controller output action must be changed (**CONF / Contr / CAct** = 1).

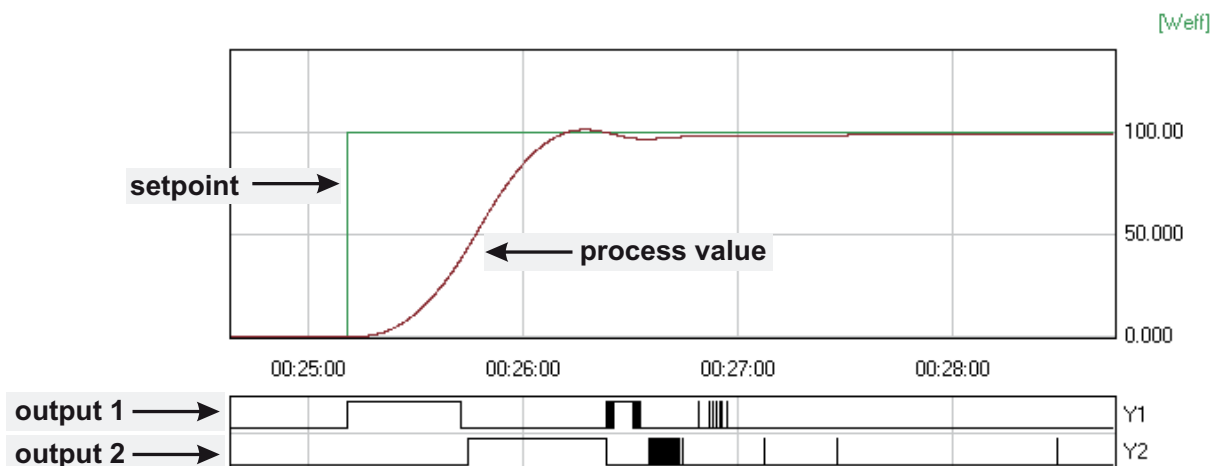


4.5.5 Continuous controller (inverse)

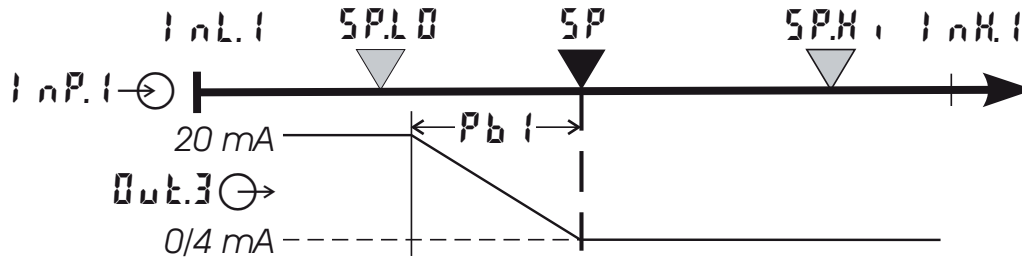

<code>CONF / Contr:</code>	<code>SPFn</code>	<code>= 0</code>	set-point controller
	<code>CFnc</code>	<code>= 1</code>	continuous controller (PID)
	<code>CAct</code>	<code>= 0</code>	inverse action (e.g. heating applications)
<code>CONF / Out.3:</code>	<code>OutYP</code>	<code>= 1/2</code>	<code>Out.3</code> type (0/4 ... 20mA)
	<code>Out.0</code>	<code>= -1999...9999</code>	scaling analog output 0/4mA
	<code>Out.1</code>	<code>= -1999...9999</code>	scaling analog output 20mA
<code>PARA / Contr:</code>	<code>Pb1</code>	<code>= 1...9999</code>	proportional band 1 (heating) in units of phys. quantity (e.g. °C)
	<code>t.i1</code>	<code>= 0,1...9999</code>	integral time 1 (heating) in sec.
	<code>t.d1</code>	<code>= 0,1...9999</code>	derivative time 1 (heating) in sec.
	<code>t1</code>	<code>= 0,4...9999</code>	min. cycle time 1 (heating)
<code>PARA / SEtP:</code>	<code>SP.L0</code>	<code>= -1999...9999</code>	set-point limit low for Weff
	<code>SP.H,1</code>	<code>= -1999...9999</code>	set-point limit high for Weff

- i** For direct action of the continuous controller, the controller action must be changed (`CONF / Contr / CAct = 1`).
- i** To prevent control outputs `Out.1` and `Out.2` of the continuous controller from switching simultaneously, the control function of outputs `Out.1` and `Out.2` must be switched off (`CONF / Out.1` and `Out.2 / Y.1` and `Y.2 = 0`).


4.5.6 ΔZ Y - Off controller / 2-point controller with pre-contact

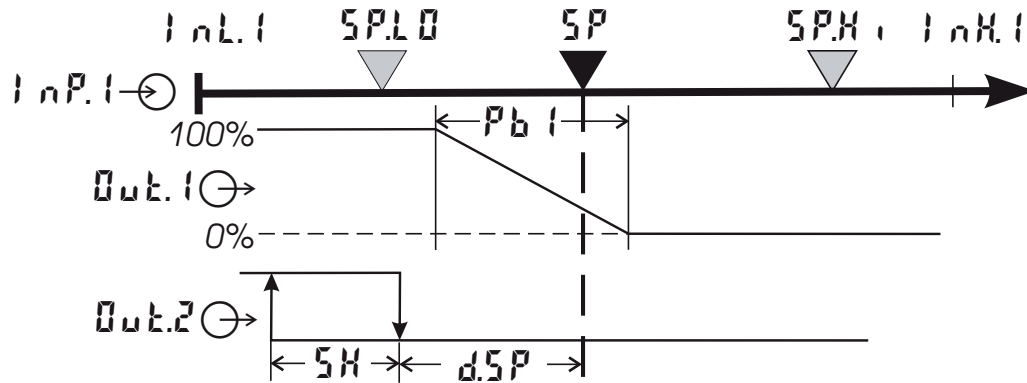

CONF / Contr:	SPFn = 0	set-point controller
	CFnc = 2	Δ -Y-Off controller
	CAct = 0	inverse action (e.g. heating applications)
CONF / Out.1:	OAct = 0	action Out.1 direct
	Y1 = 1	control output Y1 active
	Y2 = 0	control output Y2 not active
CONF / Out.2:	OAct = 0	action Out.2 direct
	Y1 = 0	control output Y1 not active
	Y2 = 1	control output Y2 active
PARA / Contr:	Pbl = 1...9999	proportional band 1 (heating) in units of phys. quantity (e.g. °C)
	t1 = 0,1...9999	integral time 1 (heating) in sec.
	td1 = 0,1...9999	derivative time 1 (heating) in sec.
	t1 = 0,4...9999	min. cycle time 1 (heating)
	SH = 0...9999	switching difference
	d.SP = -1999...9999	trigg. point separation suppl. cont. Δ / Y / Off in units of phys. quanti-
ty PARA / SEtP:	SP.L0 =	
-1999...9999		set-point limit low for Weff
	SP.H.1 = -1999...9999	set-point limit high for Weff

4.5.7 Continuous controller with position controller



($Enter / Func = 6$)

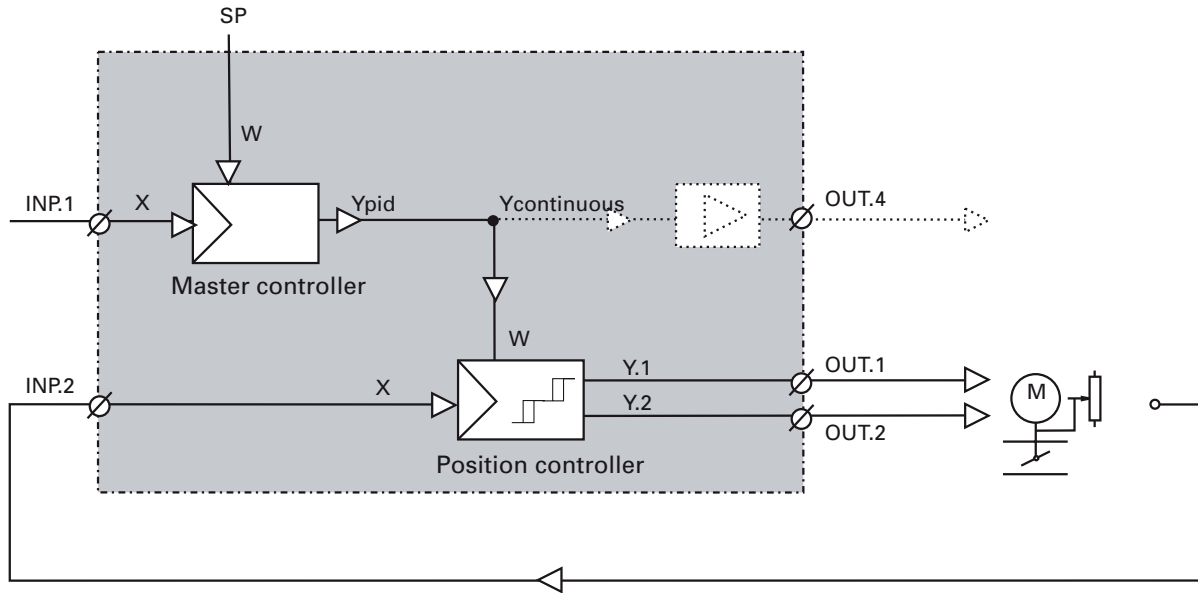

Basically, this controller function is a cascade. A slave controller with three-point stepping behaviour working with position feedback Y_p as process value (INP2 or INP3) is added to a continuous controller.

$CONF / Enter$	$SPFn = 0$	setpoint controller
	$Func = 6$	continuous controller with position controller
	$Act = 0$	inverse output action (e.g. heating applications)
$CONF / InP.2:$	$Func = 3$	position feedback Y_p
	$StYP = 50$	sensor e.g. potentiometer 0..160 Ω
$CONF / Out.1:$	$Act = 0$	direct output action $Out.1$
	$Y.1 = 1$	control output Y1 active
	$Y.2 = 0$	control output Y2 not active
$CONF / Out.2:$	$Act = 0$	direct output action $Out.2$
	$Y.1 = 0$	control output Y1 not active
	$Y.2 = 1$	control output Y2 active
$PARA / Enter:$	$Pb1 = 0,1...9999$	proportional band 1 (heating) in units of the physical quantity (e.g. $^{\circ}C$)
	$t_i1 = 1...9999$	integral time 1 (heating) in sec.
	$t_d1 = 1...9999$	derivative time 1 (heating) in sec.
	$t1 = 0,4...9999$	min. cycle tim 1 (heating)
	$SH = 0...9999$	switching difference

4.5.8 Measured value output

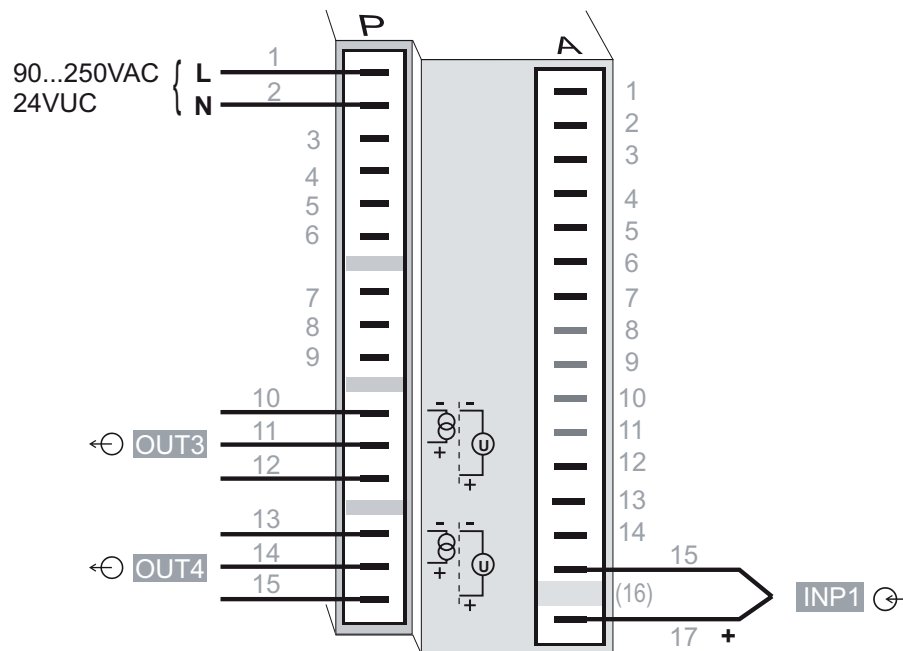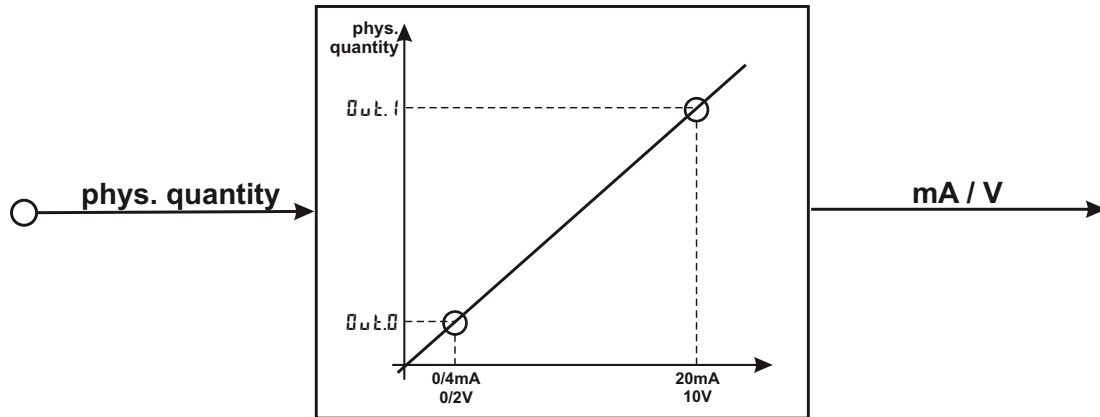

CONF / Out.3 / 4: Out.YP = 1	Out.3 / 4 0...20mA continuous
= 2	Out.3 / 4 4...20mA continuous
= 3	Out.3 / 4 0...10V continuous
= 4	Out.3 / 4 2...10V continuous
Out.0 = -1999...9999	scaling Out.3 / 4
Out.1 = -1999...9999	for 0.4mA or 0.2V
	scaling Out.3 / 4
	for 20mA or 10V
Out.5rc = 3	signal source for Out.3 / 4 is
	the process value

5 Parameter setting level

5.1 Parameter survey

PRR Parameter setting level								
	Enter Control and self-tuning	PRr.2 2. set of parameters	SEtP Set-point and process value	Input 1 InP.1	Input 2 InP.2	Input 3 InP.3	Limit value functions Lin	End
▲	Pb1	Pb12	SPLo	InL.1	InL.2	InL.3	L.1	
▼	Pb2	Pb22	SPH.1	OutL.1	OutL.2	OutL.3	H.1	
	t.1	t.12	SP.2	InH.1	InH.2	InH.3	HYS.1	
	t.2	t.22	r.SP	OutH.1	OutH.2	OutH.3	dEL.1	
	Ed1	Ed12		tF.1	tF.2	tF.3	L.2	
	Ed2	Ed22		E.t.c		E.t.c	H.2	
	t.1						HYS.2	
	t.2						dEL.2	
	SH						L.3	
	HYS.L						H.3	
	HYS.H						HYS.3	
	dSP						dEL.3	
	tP						H.C.R	
	t.t							
	YL0							
	YH.1							
	Y2							
	Y0							
	Yn.H							
	L.Yn							
	EM20							
	t.on							
	t.oFF							
	FH2							
	oFFS							
	tE.nP							

Adjustment:

- The parameters can be adjusted by means of keys ▲▼
- Transition to the next parameter is by pressing key ↵
- After the last parameter of a group, donE is displayed, followed by automatic change to the next group.



Return to the beginning of a group is by pressing the key for 3 sec. If for 30 sec. no keypress is executed the controller returns to the process value and setpoint display (Time Out = 30 sec.)

5.2 Parameters

Enter

Name	Value range	Description	Default
Pb1	1...9999 ①	Proportional band 1 (heating) in phys. dimensions (e.g. °C)	100
Pb2	1...9999 ①	Proportional band 2 (cooling) in phys. dimensions (e.g. °C)	100
t1	0,1...9999	Integral action time 1 (heating) [s]	180
t2	0,1...9999	Integral action time 2 (cooling) [s]	180
td1	0,1...9999	Derivative action time 1 (heating) [s]	180
td2	0,1...9999	Derivative action time 2 (cooling) [s]	180
t1	0,4...9999	Minimal cycle time 1 (heating) [s]. The minimum impulse is 1/4 x t1	10
t2	0,4...9999	Minimal cycle time 2 (heating) [s]. The minimum impulse is 1/4 x t2	10
SH	0...9999	Neutral zone or switching differential for on-off control [phys. dimensions]	2
HYSL	0...9999	Switching difference Low signaller [engineering unit]	1
HYSH	0...9999	Switching difference High signaller [engineering unit]	1
dSP	-1999...9999	Trigger point separation for additional contact Δ / Y / Off [phys. dimensions]	100
EP	0,1...9999	Minimum impulse [s]	OFF
ET	3...9999	Motor travel time [s]	60
YLo	-120...120	Lower output limit [%]	0
YHi	-120...120	Upper output limit [%]	100
Y2	-100...100	2. correcting variable	0
Y0	-100...100	Working point for the correcting variable [%]	0
Ym	-100...100	Limitation of the mean value Ym [%]	5
LYn	0...9999	Max. deviation xw at the start of mean value calculation [phys. dimensions]	8
EX20	-1999...9999	Min. temperature for water cooling. Below the set temperature no water cooling happens	0
EOH	0,1...9999	Impulse length for water cooling. Fixed for all values of controller output. The pause time is varied.	1
EOFF	1...9999	Min. pause time for water cooling. The max. effective controller output results from $EOH / (EOH + EOFF) \square 100\%$	10
FX20	0,1...9999	Modification of the (non-linear) water cooling characteristic (see page 46)	1
OFFS	-120...120	Zero offset	0
TEMP	0...9999	Sensor temperature (in engineering units e.g. °C) With oxygen measurement (O) (see page 66)	750

① Valid for $EOH / OFF / dP = 0$. With $dP = 1 / 2 / 3$ also 0,1 / 0,01 / 0,001 is possible.

PAR.2

Name	Value range	Description	Default
Pb12	1...9999 ①	Proportional band 1 (heating) in phys. dimensions (e.g. °C), 2. parameter set	100
Pb22	1...9999 ①	Proportional band 2 (cooling) in phys. dimensions (e.g. °C), 2. parameter set	100
t122	0,1...9999	Integral action time 2 (cooling) [s], 2. parameter set	10
t112	0,1...9999	Integral action time 1 (heating) [s], 2. parameter set	10
td12	0,1...9999	Derivative action time 1 (heating) [s], 2. parameter set	10
td22	0,1...9999	Derivative action time 2 (cooling) [s], 2. parameter set	10

SELP

Name	Value range	Description	Default
SPLO	-1999...9999	Set-point limit low for Weff	0
SPHi	-1999...9999	Set-point limit high for Weff	900
SP2	-1999...9999	Set-point 2.	0
r.SP	0...9999	Set-point gradient [/min]	OFF
SP	-1999...9999	Set-point (only visible with BlueControl!)	0



SPLO and SPHi should be within the limits of r.nGH and r.nGL see configuration → Controller page

INP.1

Name	Value range	Description	Default
INL1	-1999...9999	Input value for the lower scaling point	0
OUT1	-1999...9999	Displayed value for the lower scaling point	0
INH1	-1999...9999	Input value for the upper scaling point	20
OUH1	-1999...9999	Displayed value for the lower scaling point	20
TF1	0,0...9999	Filter time constant [s]	0,5
Etc.1	0...100 (°C) 32...212 (°F)	External cold-junction reference temperature (external TC)	OFF

INP.2

Name	Value range	Description	Default
INL2	-1999...9999	Input value for the lower scaling point	0
OUT2	-1999...9999	Displayed value for the lower scaling point	0
INH2	-1999...9999	Input value for the upper scaling point	50
OUH2	-1999...9999	Displayed value for the upper scaling point	50
TF2	0,0...9999	Filter time constant [s]	0,5

INP.3

Parameter setting level

Name	Value range	Description	Default
InL3	-1999...9999	Input value for the lower scaling point	0
OutL3	-1999...9999	Displayed value for the lower scaling point	0
InH3	-1999...9999	Input value for the upper scaling point	20
OutH3	-1999...9999	Displayed value for the upper scaling point	20
TF3	-1999...9999	Filter time constant [s]	0
ExtC3	0...100 (°C) 32...212 (°F)	External cold-junction reference temperature (external TC)	OFF

L iñ

Name	Value range	Description	Default
L.1	-1999...9999	Lower limit 1	10
H.1	-1999...9999	Upper limit 1	10
HYS.1	0...9999	Hysteresis limit 1	1
dEL.1	0...9999	Alarm delay from limit value 1	0
L.2	-1999...9999	Lower limit 2	OFF
H.2	-1999...9999	Upper limit 2	OFF




Resetting the controller configuration to factory setting (Default) or resetting to the customer-specific default data set

→ chapter 11.1 (Page 80)

5.3 Input scaling

When using current, voltage or resistance signals as input variables for $I_{nP.1}$, $I_{nP.2}$ or/and $I_{nP.3}$ scaling of input and display values at parameter setting level is required. Specification of the input value for lower and higher scaling point is in the relevant electrical unit (mA / V / Ω).

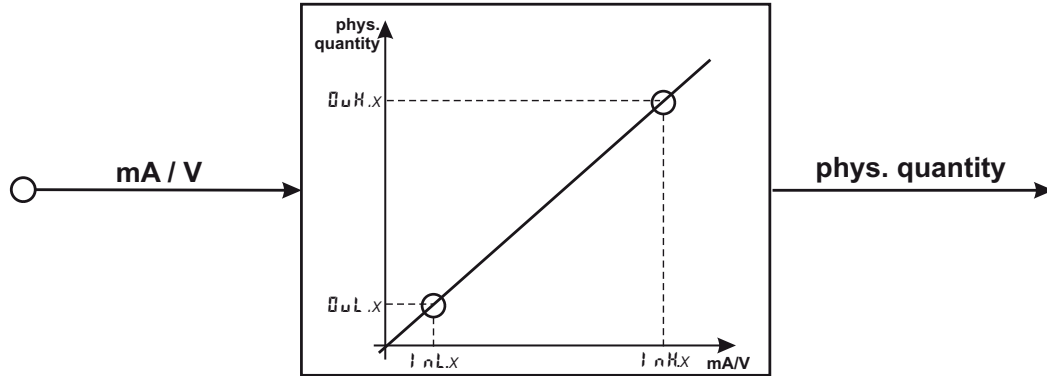

SETP	Input signal	$I_{nL,x}$	$Q_{uL,x}$	$I_{nH,x}$	$Q_{uH,x}$
30 (0...20mA)	0 ... 20 mA	0	any	20	any
	4 ... 20 mA	4	any	20	any
40 (0...10V)	0 ... 10 V	0	any	10	any
	2 ... 10 V	2	any	10	any

5.3.1 Input $I_{nP.1}$ and $I_{nP.3}$

i Parameters $I_{nL,x}$, $Q_{uL,x}$, $I_{nH,x}$ and $Q_{uH,x}$ are only visible if $CONF / I_{nP.x} / CORR = 3$ is chosen.

In addition to these settings, $I_{nL,x}$ and $I_{nH,x}$ can be adjusted in the range (0...20mA / 0...10V / Ω) determined by selection of SETP.

! For using the predetermined scaling with thermocouple and resistance thermometer (Pt100), the settings for $I_{nL,x}$ and $Q_{uL,x}$ and for $I_{nH,x}$ and $Q_{uH,x}$ must have the same value.

i Input scaling changes at calibration level (\rightarrow page 61) are displayed by input scaling at parameter setting level. After calibration reset (OFF), the scaling parameters are reset to default.

5.3.2 Input $I_{nP.2}$

SETP	Input signal	$I_{nL,2}$	$Q_{uL,2}$	$I_{nH,2}$	$Q_{uH,2}$
30	0 ... 20 mA	0	any	20	any

In addition to these settings, $I_{nL,2}$ and $I_{nH,2}$ can be adjusted in the range (0...20/ 50mA/ Ω) determined by selection of SETP.

6 Calibration level


Measured value correction (ϵ_{RL}) is only visible if $\epsilon_{conf} / \epsilon_{inp.1} / \epsilon_{corr} = 1$ or 2 is chosen.

The measured value can be matched in the calibration menu (ϵ_{RL}). Two methods are available:

Offset correction

($\epsilon_{conf} / \epsilon_{inp.1} / \epsilon_{corr} = 1$):


- possible on-line at the process

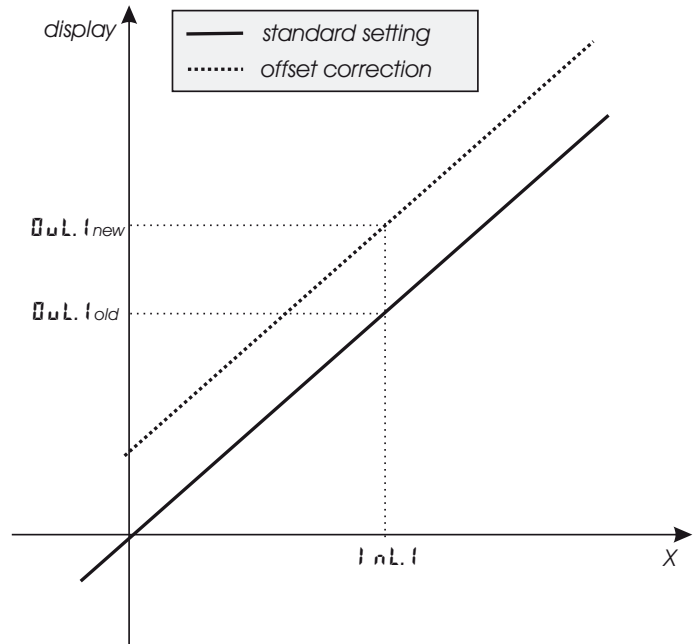


2-point correction

($\epsilon_{conf} / \epsilon_{inp.1} / \epsilon_{corr} = 2$):

- is possible off-line with process value simulator

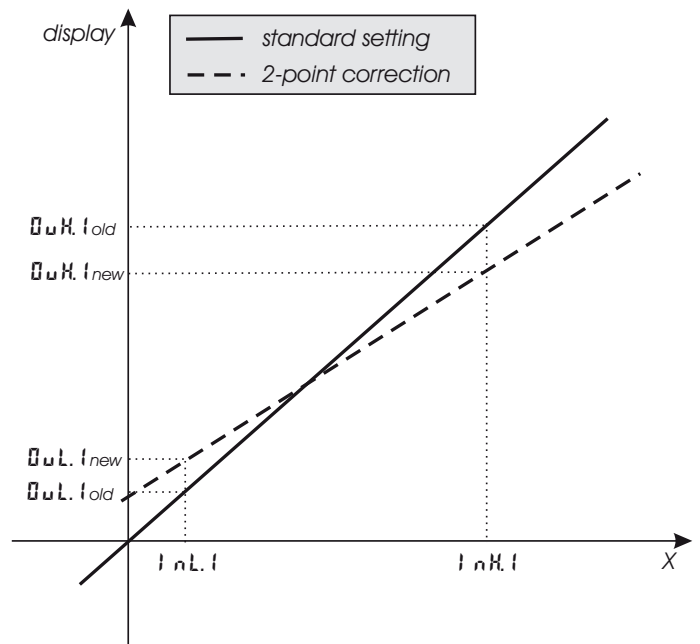


Offset correction ($\text{CONF} / \text{INP.1} / \text{CORR} = 1$):

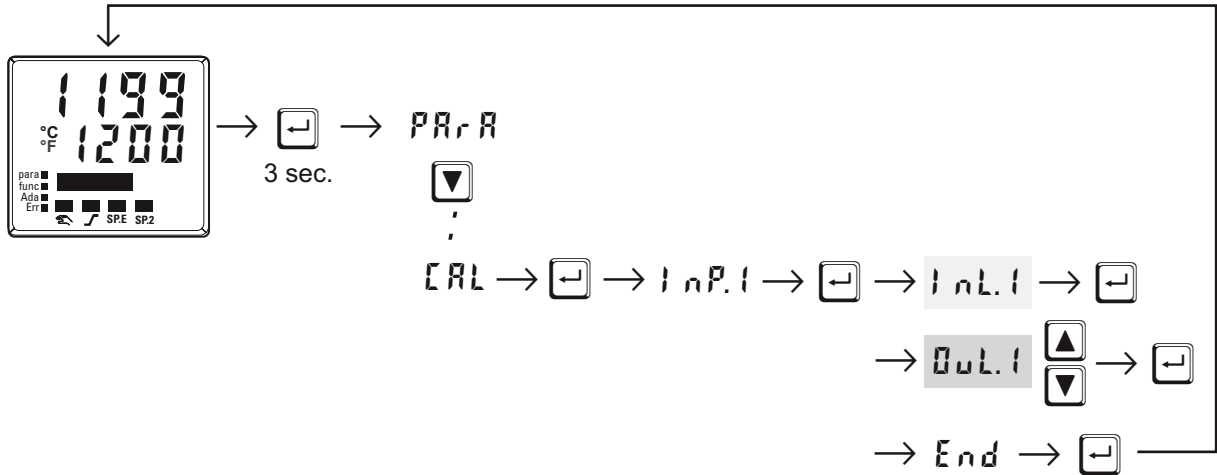

- INL.1:** The input value of the scaling point is displayed.
The operator must wait, until the process is at rest.
Subsequently, the operator acknowledges the input value by pressing key .
- OVL.1:** The display value of the scaling point is displayed.
Before calibration, **OVL.1** is equal to **INL.1**.
The operator can correct the display value by pressing keys .
Subsequently, he confirms the display value by pressing key .

2-point correction (CONF / InP.1 / Corr = 2):

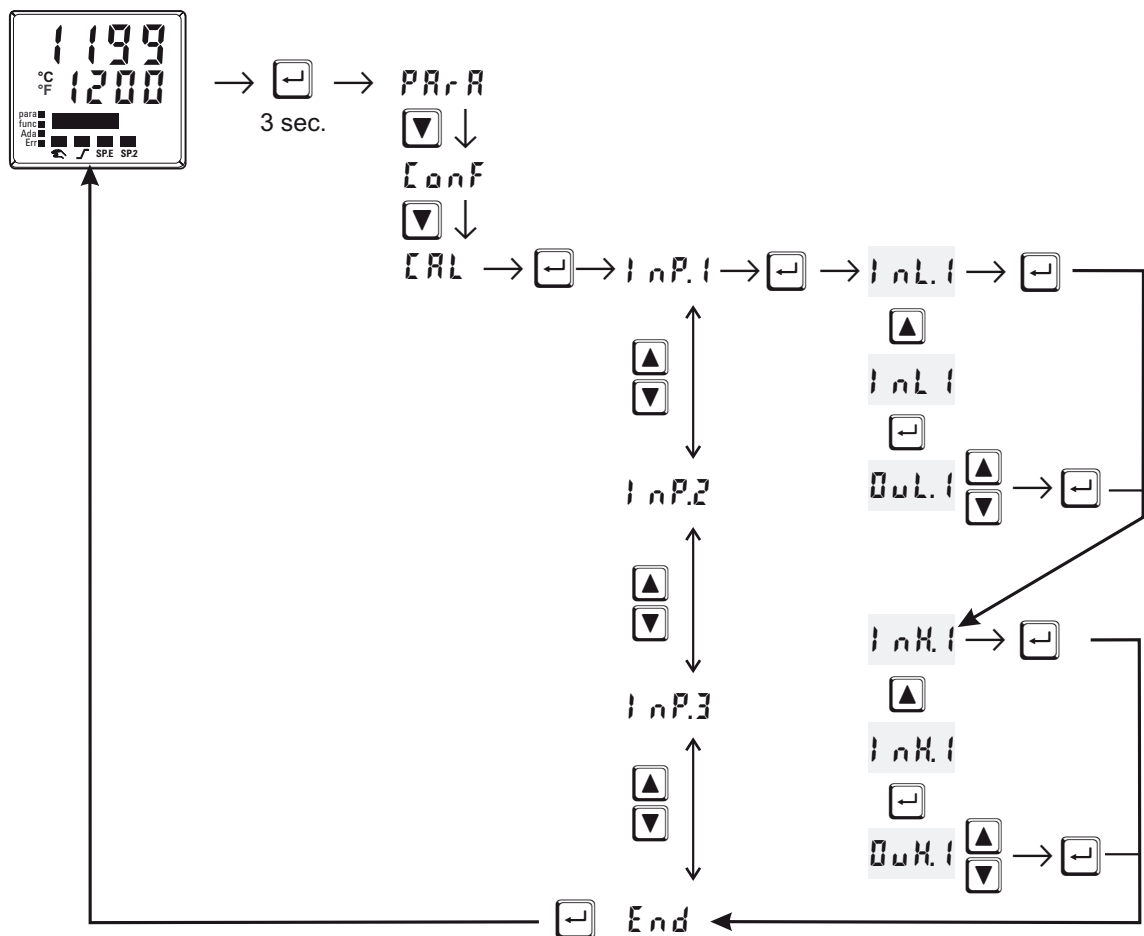

- InL.1:** The input value of the lower scaling point is displayed.
The operator must adjust the lower input value by means of a process value simulator and confirm the input value by pressing key
- QuL.1:** The display value of the lower scaling point is displayed.
Before calibration, QuL.1 equals InL.1.
The operator can correct the lower display value by pressing the keys. Subsequently, he confirms the display value by pressing key
- InH.1:** The input value of the upper scaling point is displayed. .
The operator must adjust the upper input value by means of the process value simulator and confirm the input value by pressing key
- QuH.1:** The display value of the upper scaling point is displayed.
Before calibration QuH.1 equals InH.1.
The operator can correct the upper display value by pressing keys Subsequently, he confirms the display value by pressing key

The parameters (QuL.1, QuH.1) changed at CAL level can be reset by adjusting the parameters below the lowest adjustment value (OFF) by means of decrement key .

7 Special functions

7.1 DAC[®] – motor actuator monitoring (Digital Actor Control DAC[®])

With all controllers with position feedback Yp, the motor actuator can be monitored for functional troubles. The DAC[®] function can be started by choosing the parameter $CONF = 5$ or 6 at the configuration level ($CONF$):

- $CONF / ENTER / CONF = 5$ 3-point-stepping controller with position feedback Yp as potentiometer
- $CONF / ENTER / CONF = 6$ Continuous controller with integrated positioner and position feedback Yp as potentiometer

If an error occurs, the controller switches to manual operation (👁 - LED blinks) and no impulses are given out any longer. If one of the relays shall switch when a DAC[®] error occurs, parameter $DRCA = 1$ and inverse action $DRCT = 1$ must be selected for the relevant output $OUT.1 \dots OUT.4$ in the $CONF$ menu ($OUT.3$ and 4 only possible if $OUTYP = 0$ [relay/logic]):

- $CONF / OUT.x / DRCA = 1$ Motor actuator monitoring (DAC) active

The system detects the following stepping controller errors:

- defective motor
- defective capacitor (wrong rotating direction)
- wrong phase followers (wrong rotating direction)
- defective force transmission at spindle or drive
- excessive backlash due to wear
- jamming of the control valve e.g. due to foreign body

In these cases the controller will change to manual operation and the outputs will be switched off. Is the controller switched to automatic operation again or any modification is done the controller activates the DAC function again and the outputs will be setted.

Resetting of a DAC error:

After solving the technical problem the DAC error can be acknowledged in the error list. Thereafter the controller works again in normal operation mode.

See also chapter 3.4 "Maintenance manager / Error list", page 12 ff.

Functioning of the DAC function

No input filter should be defined for the Yp input ($PARR / InP.x / t.F x = 0$).
 Therewith no wrong detection of blocking or wrong method of operation can be recognized.

The automatic calibration can be used with drives outfitted with spring assembly.

Execution of the calibration:

It is controlled if the mean alteration between two measurements is enough for the DAC monitoring. The calibration will be stopped if the alteration between two measurements is too small.

The position of 0% is searched. Therefor the drive will be closed until there is no changing of the input signal for 0,5 sec.

Assuming that the drive is outfitted with spring assembly, the drive is opened for 2,8 sec. The drive should then still be within the spring assembly. This position is allocated and stored as 0%.

With the same procedure the position for 100% is allocated and stored.

Simultaneously the motor running time is determined and saved as parameter $t t$.




Afterwards the controller sets the drive in the position before calibration.

Was the controller in automatic mode before calibration it will be set to automatic mode again otherwise it remains in manual mode.

The following errors can be occur during calibration:

- the change of the Yp input is too small, no monitoring is possible
- the motion is in wrong direction
- the Yp input is broken

In these cases the automatic calibration will be stopped and the controller remains in manual mode.

-  If the automatic calibration leads to no reasonable results the calibration of the Yp input can be done manual.
-  If the controller reaches the positions of 0% or 100% the outputs will be switched off. Also in manual mode it is not possible to exceed these limits.
-  **Because no controller with continuous output and Yp input is defined there won't be the DAC function for this controlling type.**

7.2 O₂ measurement

This function is available only on the instrument version with INP3.

As the O₂-measurement result range can extend over many decades, automatic display switch-over between “ % ” and “ppm“ was realized.



The instantaneous unit is displayed in the lower line.

With set-point changing via keys \blacktriangle or \blacktriangledown , the unit of the set-point and of the other parameters is displayed.

Lambda probes (λ probes) are used as sensors.

The electromotive force (in Volts) generated by λ probes is dependent of instantaneous oxygen content and temperature. Therefore, KS 9x-1 can only evaluate exact measurement results, if it knows the sensor temperature.

Distinction of heated and non-heated lambda probes is made. Both can be evaluated by KS 9x-1.

Heated lambda probes

Controlled heating which ensures constant temperature is integrated in the heated λ probe. This temperature must be entered in KS 9x-1 parameter Probe temperature.

Parameter → Controller → Probe temperature →°C (/°F - dependent of configuration)

Enter → temp.	0...9999
---------------	----------

Non-heated lambda probes

With the probe always operated at a fixed, known temperature, a procedure as used for a heated probe can be used.

A non-heated λ probe is used, unless the temperature is constant. In this case, the probe temperature in addition to the probe mV value must be measured. For this purpose, any temperature measurement with one of the analog inputs INP2 or INP3 can be used. During function selection, the input must be set to X2 (second process value).

7.2.1 Connection

Connect the input for the lambda probe to INP1.

Use terminals A15 and A17.

If necessary, temperature measurement must be connected to INP2 or INP3.

7.2.2 Configuration:

Oxygen measurement

Oxygen measurement with **heated** lambda probe

Controller → Process value processing → 7: O₂ functions with constant probe temperature

Ctrlr → Etyp	7	O2-const
--------------	---	----------

Oxygen measurement with **non-heated** lambda probe

Controller → Process value processing → O₂ functions with measured probe temperature

Ctrlr → Etyp	8	O2+temp
--------------	---	---------

Input 1 → Function INP1 → 7: process value X1

INP.1 → Func	7	X1-Input
--------------	---	----------

In **input 1**, the sensor type is set for one of the high-impedance voltage inputs:

Input 1 → Sensor type → 42: special (-25...1150 mV) or

41: special (-2,5...115 mV)


INP.1 → Etyp	41	115 mV
INP.1 → Etyp	42	1150 mV

Input 1 → meas. value correction → 0: no correction

INP.1 → SL in	0	no
---------------	---	----

Temperature measurement (required with non-heated lambda probe)

Any temperature measurement with one of analog inputs INP2 or INP3 can be used. Select input X2 during function selection (second set-point).

-  With O₂ measurement, evaluation in ppm or % must be specified for all parameters related to the process value. This is done centrally during configuration.

Other → Parameter unit for O₂ → 0: parameter for O₂ function in ppm
1: parameter for O₂ function in %

o2hr → O2	0	unit : ppm
o2hr → O2	1	unit : %

-  Whether the temperature of the non-heated λ probe is specified in °C or °F can be selected during configuration.

Other → Unit → 1: in Celsius

2: in Fahrenheit

o2hr → Unit	1	°C
o2hr → Unit	2	°F

7.3 Linearization

Linearization for inputs INP1 or INP3

Access to table "L n" is always with selection of sensor type S.TYP = 18: special thermocouple in INP1 or INP3, or with selection of linearization 5.L n 1: special linearization.


Dependent of input type, the input signals are specified in μV or in Ohm dependent of input type.

With up to 16 segment points, non-linear signals can be simulated or linearized. Every segment point comprises an input ($I_{n.1} \dots I_{n.16}$) and an output ($O_{u.1} \dots O_{u.16}$). These segment points are interconnected automatically by means of straight lines. The straight line between the first two segments is extended downwards and the straight line between the two largest segments is extended upwards. I.e. a defined output value is also provided for each input value.

When switching an $I_{n.x}$ value to OFF, all other ones are switched off.

Condition for these configuration parameters is an ascending order.

$I_{n.1} < I_{n.2} < \dots < I_{n.16}$ and $O_{u.1} < O_{u.2} \dots < O_{u.16}$.

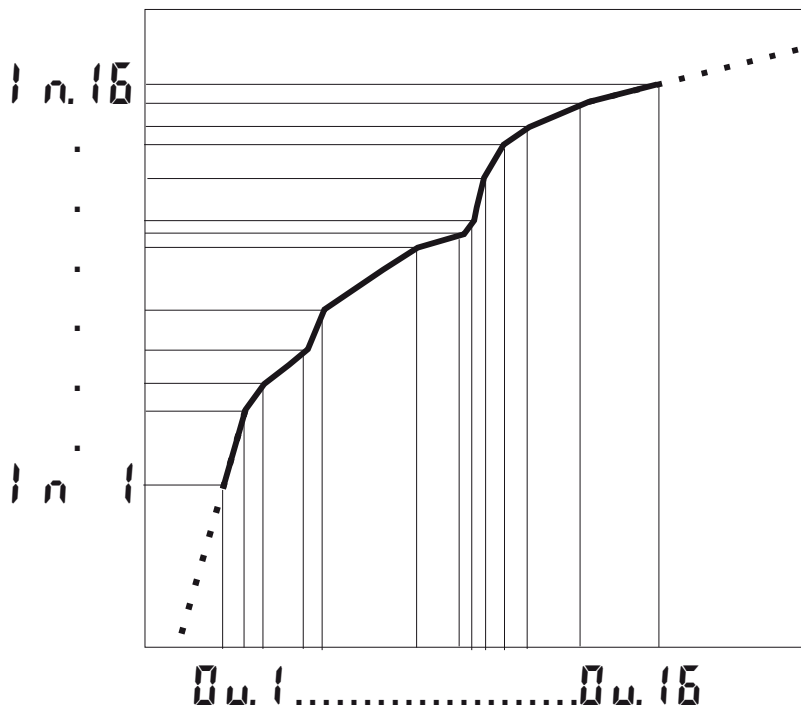

7.4 Loop alarm

The loop alarm monitors the control loop for interruption (not with three-point stepping controller and not with signallers.)

With parameter **LP.AL** switched to **1** (= loop alarm active), an interruption of the control loop is detected, unless the process value reacts accordingly with $Y=100\%$ after elapse of $2 \times T_i$.

The loop alarm shows that the control loop is interrupted. You should check heating or cooling circuit, sensor, controller and motor actuator.

During self-tuning, the control loop is not monitored (loop alarm is not active).

7.5 Heating current input / heating current alarm

The heating current alarm monitors the heating current.

In addition to short circuit monitoring, checking either for overload (current > heating current limit value) or for interruption (current < heating current limit value) is done.

Each of the analog inputs can be used as measurement input.

If electrical heating is concerned, INP2 which is always provided can be configured for measuring range 0...50mA AC and connected directly using a heating current transformer.



With $t_i < 400$ ms or $t_P < 200$ ms (effective time!), heating current monitoring is ineffective.

7.6 MIR-49x als Modbus-Master



This function is only selectable with BlueControl (engineering tool)!

Additions $\alpha \xi \eta \rho$ (only visible with BlueControl!)

Name	Value range	Description	Default
MASt		Controller is used as Modbus master	0
	0	Slave	
	1	Master	
Cycl	0...200	Cycle time [ms] for the Modbus master to transmit its data to the bus.	60
AdrO	1...65535	Target address to which the with AdrU specified data is given out on the bus.	1
AdrU	1...65535	Modbus address of the data that Modbus master gives to the bus.	1

The KS9x-1 can be used as Modbus master ($\xi \alpha \eta \rho / \alpha \xi \eta \rho / \text{MASt} = 1$). The Modbus master sends its data to all slaves (Broadcast message, controller address 0). It transmits its data (modbus address **AdrU**) cyclic with the cycle time **Cycl** to the bus. The slave controller receives the data transmitted by the masters and allocates it to the modbus target address **AdrO**. If more than one data should be transmitted by the master controller ($\text{Numb} > 1$), the modbus address **AdrU** indicates the start address of the data that should be transmitted and **AdrO** indicates the first target address where the received data should be stored. The following data will be stored at the logically following modbus target addresses.

With this it is possible e.g. to specify the process value of the master controller as set-point for the slave controllers.

7.7 Back-up controller (PROFIBUS)

Back-up operation: calculation of the control outputs is in the master. The controller is used for process value measurement, correcting variable output and for display.

With master or communication failure, control is taken over independently and bumplessly by the controller.

8 BlueControl


BlueControl is the projection environment for the BluePort® controller series. The following 3 versions with graded functionality are available:

Functionality	Mini	Basic	Expert
Parameter and configuration setting	yes	yes	yes
Controller and loop simulation	yes	yes	yes
Download: transfer of an engineering to the controller	yes	yes	yes
Online mode / visualization	SIM only	yes	yes
Defining an application specific linearization	yes	yes	yes
Configuration in the extended operating level	yes	yes	yes
Upload: reading an engineering from the controller	SIM only	yes	yes
Basic diagnostic functions	no	no	yes
Saving data file and engineering	no	yes	yes
Printer function	no	yes	yes
Online documentation, help	yes	yes	yes
Implementation of measurement value correction	yes	yes	yes
Data acquisition and trend display	SIM only	yes	yes
Wizard function	yes	yes	yes
Extended simulation	no	no	yes
Customer-specific default data-set	no	no	yes
Programeditor (KS 90-1 programmer only)	no	no	yes
Support for the "railline"-system	no	no	yes

The mini version is - free of charge - at your disposal as download at ACS homepage www.acs-controlsystem.de or on the CD (please ask for).

At the end of the installation the licence number has to be stated or DEMO mode must be chosen.

At DEMO mode the licence number can be stated subsequently under *Help* → *Li-
cense* → *Change*.

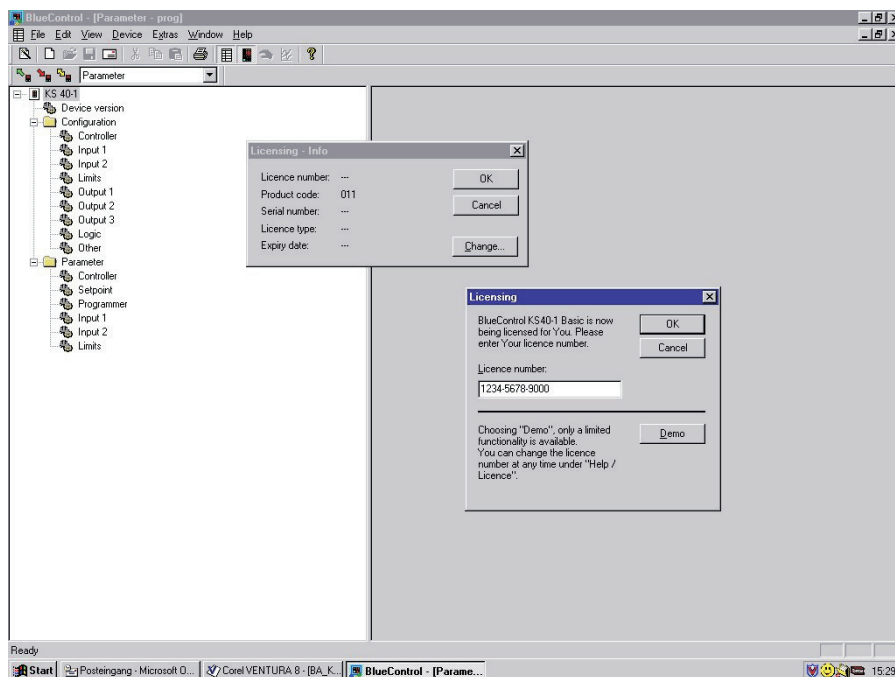

9 Versions



MIR-491



MIR-492

MIR-491-

MIR-492-

- 0 connection via flat-pin terminal
 - 1 connection via screw terminals
- 0 90...250V AC, 4 relay
 - 1 24V AC / 18...30V DC, 4 relay
 - 2 90...250V AC, 3 relay + mA / V / logic
 - 3 24V AC / 18...30V DC, 3 relay + mA / V / logic
 - 4 90...250V AC, 2 relay + 2 x mA / V / logic
 - 5 24V AC / 18...30V DC, 2 relay + 2 x mA / V / logic
- 0 no bus interface
 - 1 RS422/RS485 + transmitter supply + di2, di3 + OUT5, OUT6
 - 2 PROFIBUS-DP + UT + di2/di3 + OUT5/OUT6
- 0 INP1 and INP2
 - 1 INP1, INP2 and INP3
- 0 controller
 - 1 program controller with 8 programs * 1)
 - 2 program controller with 16 programs * 1)
- 0 standard configuration
 - 9 configuration as specified
- 0 no operating instructions
 - D operating instructions german
 - E operating instructions english
 - F operating instructions french
- 0 standard
 - U UL-certificated
 - D certificated according to EN 14597 (ersetzt DIN 3440)

* 1) Attention!!! please use other operation instructions!
 „program controller“ instead of standard!
 Please see additional equipment below.

Order code

MIR-49_ - S

Accessory equipment with ordering information

Description		Order no.
Heating current transformer 50A AC		9404-407-50001
PC-adaptor for the front-panel interface		9407-998-00001
Standard rail adaptor		9407-998-00061
Operating manual	German	9499-040-62918
Operating manual	English	9499-040-62911
Operating manual	French	9499-040-62932
Operating manual	Russian	9499-040-62965
Interface description Modbus RTU	German	9499-040-63718
Interface description Modbus RTU	English	9499-040-63711
BlueControl (engineering tool)	Mini	Download www.acs-controlsystem.de
BlueControl (engineering tool)	Basic	9407-999-11001
BlueControl (engineering tool)	Expert	9407-999-11011

10 Technical data

INPUTS

PROCESS VALUE INPUT INP1

Resolution:	> 14 bits
Decimal point:	0 to 3 digits behind the decimal point
Dig. input filter:	adjustable 0,000...9999 s
Scanning cycle:	100 ms
Measured value correction:	2-point or offset correction

Thermocouples

→ Table 1 (page 77)

Internal and external temperature compensation

Input resistance:	$\geq 1 \text{ M}\Omega$
Effect of source resistance:	$1 \mu\text{V}/\Omega$

Internal temperature compensation

Maximal additional error:	$\pm 0.5 \text{ K}$
---------------------------	---------------------

Sensor break monitoring

Sensor current:	$\leq 1 \mu\text{A}$
Configurable output action	

Thermocouple to specification

Measuring range -25...75mV in conjunction with the linearization can be used for connecting thermocouples which are not included in Table 1.

Resistance thermometer

→ Table 2 (page 77)

Connection:	3-wire
Lead resistance:	max. 30 Ohm
Input circuit monitor:	break and short circuit

Special measuring range

BlueControl (engineering tool) can be used to match the input to sensor KTY 11-6 (characteristic is stored in the controller).

Physical measuring range:	0...4500 Ohm
Linearization segments	16

Current and voltage signals

→ Table 3 (page 77)

Span start, end of span:	anywhere within measuring range
Scaling:	selectable -1999...9999
Linearization:	16 segments, adaptable with BlueControl
Decimal point:	adjustable
Input circuit monitor:	12.5% below span start (2mA, 1V)

SUPPLEMENTARY INPUT INP2

Resolution:	> 14 bits
Scanning cycle:	100 ms

Heating current measurement

via current transformer (→ Accessory equipment)

Measuring range:	0...50mA AC
Scaling:	adjustable -1999...0.000...9999 A

Current measuring range

Technical data as for INP1

Potentiometer

→ Table 2 (page 77)

Connection:	2-wire
Lead resistance:	max. 30 Ohm
Input circuit monitor:	Break

SUPPLEMENTARY INPUT INP3 (OPTION)

Resolution:	> 14 bits
Scanning cycle:	100 ms

Technical data as for INP1 except 10V range.

CONTROL INPUTS DI1, DI2

Configurable as switch or push-button!
Connection of a potential-free contact suitable for switching "dry" circuits.

Switched voltage:	5 V
Current:	100 μA

CONTROL INPUTS DI2, DI3 (OPTION)

The functions of control input di2 on the analog card and of di2 on the options card are logically **ORed**.

Configurable as direct or inverse switches or keys.
Optocoupler input for active triggering.

Nominal voltage	24 V DC external
Current sink (IEC 1131 type 1)	
Logic "0"	-3...5 V
Logic "1"	15...30 V
Current requirement	approx.. 5 mA

TRANSMITTER SUPPLY U_T (OPTION)

Power: 22 mA / ≥ 18 V

As analog outputs OUT3 or OUT4 and transmitter supply U_T are connected to different voltage potentials, an external galvanic connection between OUT3/4 and U_T is not permissible with analog outputs.

GALVANIC ISOLATION

- Safety isolation
- == Function isolation

Mains supply	Process value input INP1 Supplementary input INP2 Optional input INP3 Digital input di1, di2
Relay OUT1	RS422/485 interface
Relay OUT2	Digital inputs di2, 3
Relay OUT3	Universal output OUT3
Relay OUT4	Universal output OUT4
	Transmitter supply U

OUTPUTS

RELAY OUTPUTS OUT1...OUT4

Contact type:	potential-free changeover contact
Max.contact rating:	500 VA, 250 V, 2A at 48...62 Hz, resistive load
Min. contact rating:	6V, 1mA DC
Number of electrical switching cycles:	for I = 1A/2A: 800,000 / 500,000 (at ~ 250V (resistive load))

Note:

If the relays operate external contactors, these must be fitted with RC snubber circuits to manufacturer specifications to prevent excessive switch-off voltage peaks.

OUT3, 4 AS UNIVERSAL OUTPUT

Galvanically isolated from the inputs.

Freely scalable resolution: 11 bits

Current output

0/4...20 mA configurable.	
Signal range:	0...approx.22mA
Max. load:	$\leq 500 \Omega$
Load effect:	no effect
Resolution:	$\leq 22 \mu\text{A}$ (0.1%)
Accuracy	$\leq 40 \mu\text{A}$ (0.2%)

Voltage output

0/2...10V configurable	
Signal range:	0...11 V
Min. load:	2 k Ω
Load effect:	no effect
Resolution:	≤ 11 mV (0.1%)
Accuracy	≤ 20 mV (0.2%)

OUT3, 4 used as transmitter supply

Output power: 22 mA / ≥ 13 V

OUT3, 4 used as logic output

Load $\leq 500 \Omega$	0/ ≤ 20 mA
Load $> 500 \Omega$	0/ > 13 V

OUTPUTS OUT5/6 (OPTION)

Galvanically isolated opto-coupler outputs. Grounded load: common positive voltage. Output rating: 18...32 VDC; 70 mA Internal voltage drop: 1 V with I_{max} Protective circuit: built-in against short circuit, overload, reversed polarity (free-wheel diode for relay loads).

POWER SUPPLY

Dependent of order:

AC SUPPLY

Voltage:	90...250 V AC
Frequency:	48...62 Hz
Power consumption	approx. 10 VA

UNIVERSAL SUPPLY 24 V UC

AC voltage:	20.4...26.4 V AC
Frequency:	48...62 Hz
DC voltage:	18...31 V DC class 2
Power consumption:	approx.. 10 VA

BEHAVIOUR WITH POWER FAILURE

Configuration, parameters and adjusted set-points, control mode:
Non-volatile storage in EEPROM

BLUEPORT FRONT INTERFACE

Connection of PC via PC adapter (see „Accessory equipment“). The BlueControl software is used to configure, set parameters and operate the MIR-49x.

BUS INTERFACE (OPTION)

Galvanically isolated

Physical: RS 422/485

Protocol: Modbus RTU

Transmission speed: 2400, 4800, 9600, 19.200 bits/sec

Address range: 1...247

Number of controllers per bus: 32

Repeaters must be used to connect a higher number of controllers.

ENVIRONMENTAL CONDITIONS

Protection modes

Front panel: IP 65 (NEMA 4X)

Housing: IP 20

Terminals: IP 00

Permissible temperatures

For specified accuracy: 0...60°C

Warm-up time: ≥ 15 minutes

For operation: -20...65°C

For storage: -40...70°C

Humidity

75% yearly average, no condensation

Altitude

To 2000 m above sea level

Shock and vibration

Vibration test Fc (DIN 68-2-6)

Frequency: 10...150 Hz

Unit in operation: 1g or 0.075 mm

Unit not in operation: 2g or 0.15 mm

Shock test Ea (DIN IEC 68-2-27)

Shock: 15g

Duration: 11ms

Electromagnetic compatibility

Complies with EN 61 326-1

(for continuous, non-attended operation)

GENERAL

Housing

Material: Makrolon 9415 flame-retardant

Flammability class: UL 94 V0, self-extinguishing

Plug-in module, inserted from the front

Safety test

Complies with EN 61010-1 (VDE 0411-1):

Overvoltage category II

Contamination class 2

Working voltage range 300 V

Protection class II

Certifications

Type tested to EN 14597 (replaces DIN 3440)

With certified sensors applicable for:

- Heat generating plants with outflow temperatures up to 120°C to DIN 4751
- Hot-water plants with outflow temperatures above 110°C to DIN 4752
- Thermal transfer plants with organic transfer media to DIN 4754
- Oil-heated plants to DIN 4755

cULus-certification

(Type 1, indoor use)

File: E 208286

Electrical connections

- flat-pin terminals 1 x 6.3mm or 2 x 2.8mm to DIN 46 244 or
- screw terminals for 0.5 to 2.5mm²
On instruments with screw terminals, the insulation must be stripped by min.12 mm. Choose end crimps accordingly.

Mounting

Panel mounting with two fixing clamps at top/ bottom or right/left, high-density mounting possible

Mounting position: uncritical
Weight: 0.27kg

Accessories delivered with the unit

Operating manual
Fixing clamps

Table 1 Thermocouples measuring ranges

Thermoelementtype		Measuring range		Accuracy	Resolution (∅)
L	Fe-CuNi (DIN)	-100...900°C	-148...1652°F	≤ 2K	0.1 K
J	Fe-CuNi	-100...1200°C	-148...2192°F	≤ 2K	0.1 K
K	NiCr-Ni	-100...1350°C	-148...2462°F	≤ 2K	0.2 K
N	Nicrosil/Nisil	-100...1300°C	-148...2372°F	≤ 2K	0.2 K
S	PtRh-Pt 10%	0...1760°C	32...3200°F	≤ 2K	0.2 K
R	PtRh-Pt 13%	0...1760°C	32...3200°F	≤ 2K	0.2 K
T	Cu-CuNi	-200...400°C	-328...752°F	≤ 2K	0.05 K
C	W5%Re-W26%Re	0...2315°C	32...4199°F	≤ 2K	0.4 K
D	W3%Re-W25%Re	0...2315°C	32...4199°F	≤ 2K	0.4 K
E	NiCr-CuNi	-100...1000°C	-148...1832°F	≤ 2K	0.1 K
B*	PtRh-Pt6%	0(100)...1820°C	32(212)...3308°F	≤ 2K	0.3 K

* Specifications valid for 400°C

Table 2 Resistance transducer measuring ranges

Type	Signal Current	Measuring range		Accuracy	Resolution (∅)
Pt100	0,2mA	-200...100°C (150**)	-140...212°F	≤ 1K	0.1K
Pt100		-200...850°C	-140...1,562°F	≤ 1K	0.1K
Pt1000		-200...850°C	-140...1562°F	≤ 2K	0.1K
KTY 11-6 *		-50...150°C	-58...302°F	≤ 2K	0.05K
Spezial		0...4,500		≤ 0.1 %	0.01 %
Spezial		0...450			
Poti		0...160			
Poti		0...450			
Poti		0...1,600			
Poti		0...4,500			

* Or special

**Measuring range 150°C with reduced lead resistance. Max. 160 Ω for meas. and lead resistances (150°C ≙ 157,33 Ω).

Table 3 Current and voltage measuring ranges

Measuring range	Input impedance	Accuracy	Resolution (∅)
0-10 Volt	≈ 110 kΩ	≤ 0.1 %	0.6 mV
-2,5-115 mV	≥ 1MΩ	≤ 0.1 %	6 μV
-25-1,150 mV	≥ 1MΩ	≤ 0.1 %	60 μV

11 Safety hints

This unit was

- built and tested in compliance with VDE 0411-1 / EN 61010-1 and
- delivered in safe condition.
- complies European guideline 89/336/EEG (EMC) and is provided with CE marking.
- tested before delivery and passed the tests required by test schedule.
- To maintain this condition and to ensure safe operation, the user must follow the hints and warnings given in this operating manual.
- The unit is intended exclusively for use as a measurement and control instrument in technical installations.



Warning

If the unit is damaged to an extent that safe operation seems impossible, the unit must not be taken into operation.

ELECTRICAL CONNECTIONS

- The electrical wiring must conform to local standards (e.g. VDE 0100).
- The input measurement and control leads must be kept separate from signal and power supply leads.
- In the installation of the controller a switch or a circuit-breaker must be used and signified.
- The switch or circuit-breaker must be installed near by the controller and the user must have easy access to the controller.

COMMISSIONING

Before instrument switch-on, check that the following information is taken into account:

- Ensure that the supply voltage corresponds to the specifications on the type label.
- All covers required for contact protection must be fitted.
- If the controller is connected with other units in the same signal loop, check that the equipment in the output circuit is not affected before switch-on. If necessary, suitable protective measures must be taken.
- The unit may be operated only in installed condition.
- Before and during operation, the temperature restrictions specified for controller operation must be met.

SHUT-DOWN

For taking the unit out of operation, disconnect it from all voltage sources and protect it against accidental operation.

If the controller is connected with other equipment in the same signal loop, check that other equipment in the output circuit is not affected before switch-off. If necessary, suitable protective measures must be taken.

MAINTENANCE, REPAIR AND MODIFICATION

The units do not need particular maintenance.



Warning

When opening the units, or when removing covers or components, live parts and terminals may be exposed.

Before starting this work, the unit must be disconnected completely.

After completing this work, re-shut the unit and re-fit all covers and components. Check if specifications on the type label must be changed and correct them, if necessary.



Caution

When opening the units, components which are sensitive to electrostatic discharge (ESD) can be exposed. The following work may be done only at workstations with suitable ESD protection.

Modification, maintenance and repair work may be done only by trained and authorized personnel. For this purpose, the service should be contacted.



The cleaning of the front of the controller should be done with a dry or a wetted (spirit, water) handkerchief.

11.1 *Resetting to factory setting,*


or to a customer-specific data set

In case of faulty configuration, the device can be reset to a default condition.


Unless changed, this basic setting is the manufacturer-specific controller default setting.


However, this setting may have been changed by means of the BlueControl® software. This is recommendable e.g. when completing commissioning in order to cancel accidental alteration easily.

Resetting can be activated as follows:

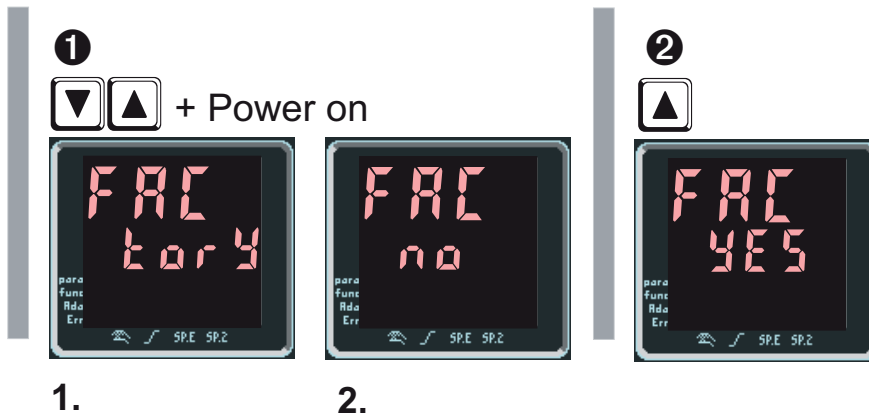

- Press keys and simultaneously **FACtorY** is displayed after power on, after approx. 2 seconds, the display changes to **FACno**.
- Keys and can be used for switch-over between **no** and **YES** in the second line.
- When pressing the Enter key with "no", the unit starts without copying the default data.
- When pressing the Enter key with "YES", there are four possibilities:

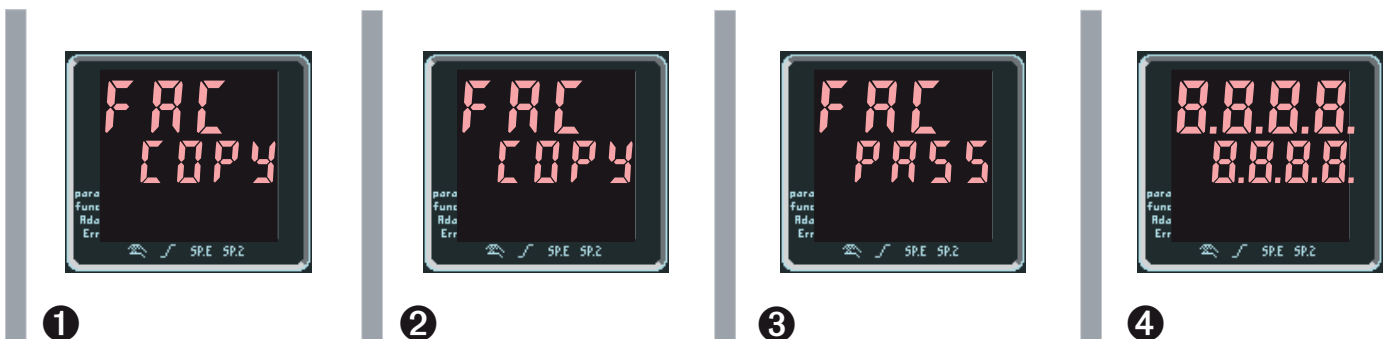

	Safety switches	Levels	Password	Instrument reaction after confirming "YES" by pressing 
①	closed	any	any	<u>always</u> factory reset
②	open	free	none	Factory reset <u>without</u> prompt for the password
③	open	free	defined	Factory reset <u>after entry</u> of the correct pass number
④	open	min. 1 disabled	any	Factory reset is <u>omitted</u>



Timeout

Unless a key is pressed during 10 seconds, a timeout occurs and the instruments starts without copying the default data.



The process **COPY** can take several seconds.

Subsequently, the instrument changes to normal operation.

Index

0-9

2-point correction. 61

A

Alarm handling 26 - 27

B

Bargraph 11

BlueControl. 71

Bus interface

- Technical Data 76

C

Calibration level (CAL) 61 - 63

Certifications 76

Configuration examples

- 2-point controller 49

- 3-point controller 50

- 3-point stepping controller 51

- Continuous controller 52

- D - Y -Off controller 53

- Measured value output 55

- Signaller. 48

Configuration level

- Configuration parameters . . . 30 - 43

- Parameter survey 29

Connecting diagram 6

Connecting examples

- di2/3, 2-wire transmitter supply . . 8

- INP2 current transformer. 7

- OUT1/2 heating/cooling 7

- OUT3 as logic output 10

- OUT3 transmitter supply 9

- RS485 interface. 9

Control inputs di1, di2, di3

- Technical data. 74

Cooling functions

- Constant period 47

- Standard. 45

- Water cooling non-linear 46

Current signal measuring range 74

D

DAC 64 - 65

Digital inputs di1, di2, di3

- Configuration 38

- Technical data. 74

E

Environmental conditions 76

Equipment 73

Error list 13

F

Front view 11

I

Input INP1

- Configuration 31

- Parameters. 58

- Technical data. 74

Input INP2

- Configuration 33

- Parameters. 58

- Technical data. 74

Input INP3

- Configuration 33

- Parameters. 59

- Technical data. 74

Input scaling 60

L

LED

- Ada - LED. 11

- Err - LED 11

- func - LED 11

-  - LED 11

- LED colours. 11

-  - LED 11

- para - LED 11

- SP.2 - LED 11

- SP.x - LED 11

Linearization	68	S	
M		Safety hints	78 - 81
Maintenance manager	13 - 15	Safety switch.	5
Manual tuning	24	Safety test.	76
Modbus master	70	Self-tuning	
Mounting.	5	- Cancellation	21
		- Cancellation causes	22
O		SEtP.	58
O2-measurement	66	Set-point	58
Offset correction	61	Set-point gradient.	44
Optimization at the setpoint	18	Set-point processing	44
Output OUT1		T	
- Configuration	36	Thermocouple measuring range	74
- Technical data.	75		
Output OUT2		V	
- Technical data.	75	Versions	72 - 73
Output OUT3		Voltage signal measuring range	74
- Configuration	37		
- Technical data.	75		
Output OUT4			
- Technical data.	75		
Output OUT5			
- Configuration	38		
- Technical data.	75		
Output OUT6			
- Configuration	38		
- Technical data.	75		
Oxygen measurement	66		
P			
Parameter setting level			
- Parameter survey	56		
- Parameters	57 - 59		
Power supply	75		
R			
Ramp	44		
Resetting to factory setting	80 - 81		
Resistance thermometer measuring range	74		



fill level



water level



pressure



temperature



flow



visualization



signal converter



sensoric



Wir erwarten Ihren Anruf.

ACS-CONTROL-SYSTEM
knowhow with system

Your partner for measuring technology and automation



ACS-CONTROL-SYSTEM GmbH
Lauterbachstr. 57
D- 84307 Eggenfelden

Tel.: +49 (0) 8721/ 9668-0
Fax: +49 (0) 8721/ 9668-30

info@acs-controlsystem.de
www.acs-controlsystem.de